# Hybrid 2l38 Traveler

August 3, 2000

## 1 Connectivity

Repairs on shorts:
Fixes for opens:

## 2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 2L38 has die: 147-050 147-051

## 3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 2l38 classification info. Created 10:47:41 07/31/00

Hybrid 2l38 quality: good
Chip classification: good good
Bad channels: none
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 31.7 30.4
```

## 4 Comments

Encapsulated. HV tested.

# 5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

**Pedestal for each Channel**

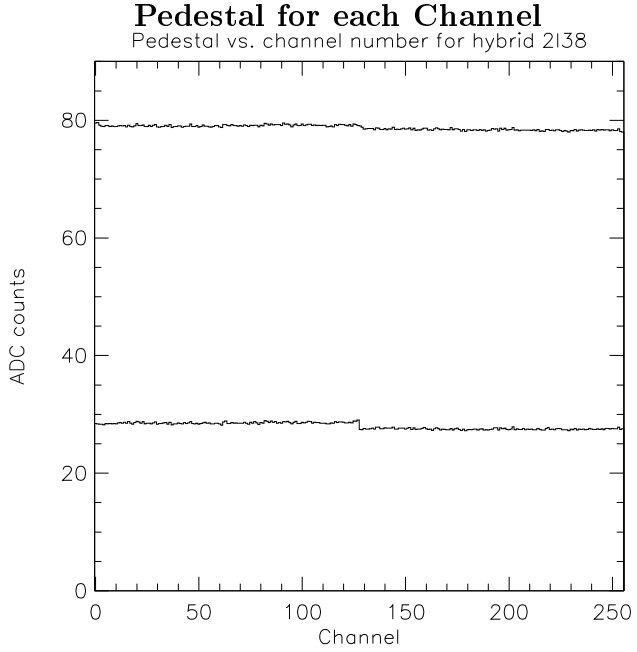


The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

**Pedestal vs. Pipeline Cell ID**

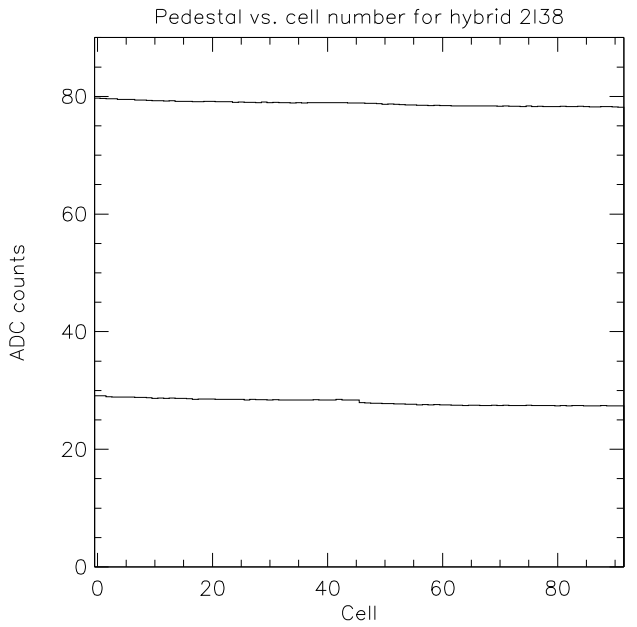

# 6 Noise

The following plots show the single-cell and multi-cell RMS noise:

**RMS Noise**

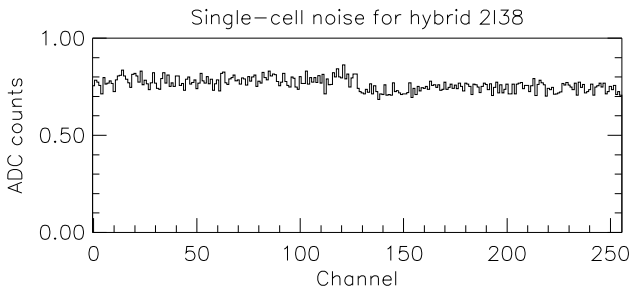


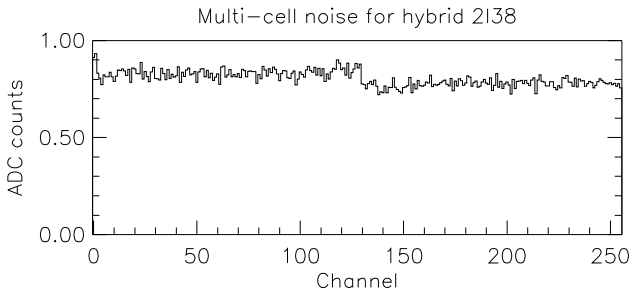


The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

**Distribution of Pedestals and Noise**

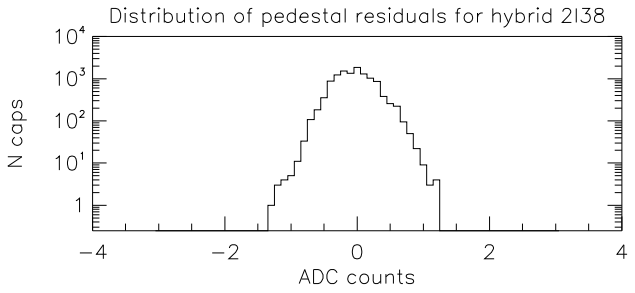


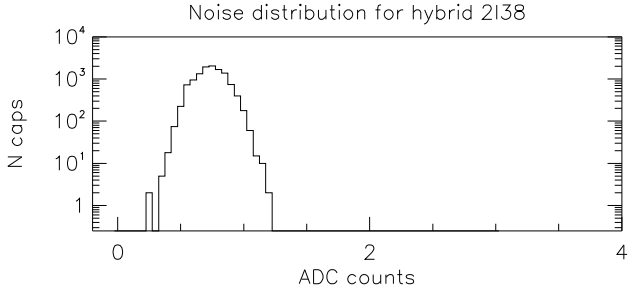

# 7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
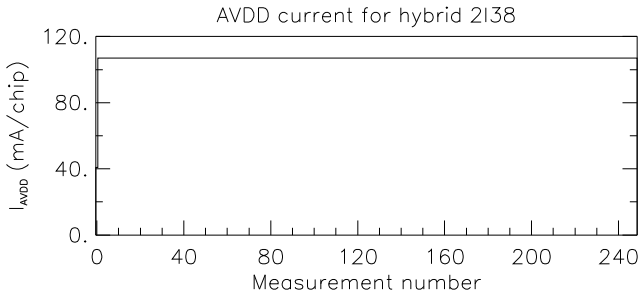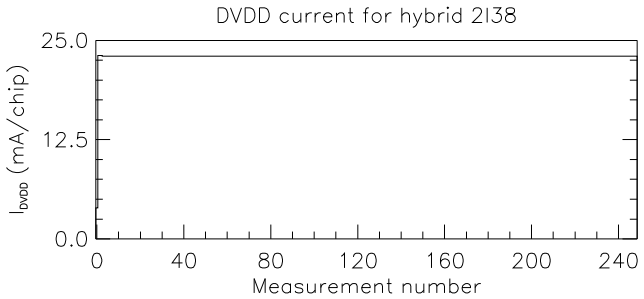
**Supply Currents During Burn-in**