Hybrid 2z135 Traveler

December 3, 1999

1 Connectivity

Repairs on shorts:

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 2Z135 has die: 055-029 055-030

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 2z135 classification info. Created 13:01:08 11/08/99

Hybrid 2z135 quality: fair
Chip classification: good fair
Bad channels: none
Bad cells: none
Random bad capacitors (chip-cell-channel): 1-16-56
Channels at pedestal needed for DCMS: 34.6 31.7
```

4 Comments

Has 4.7μF digital Caps.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

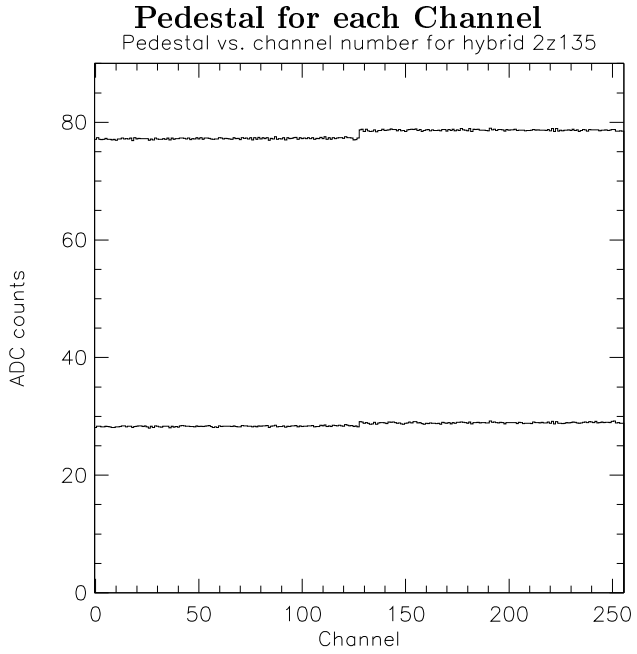

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

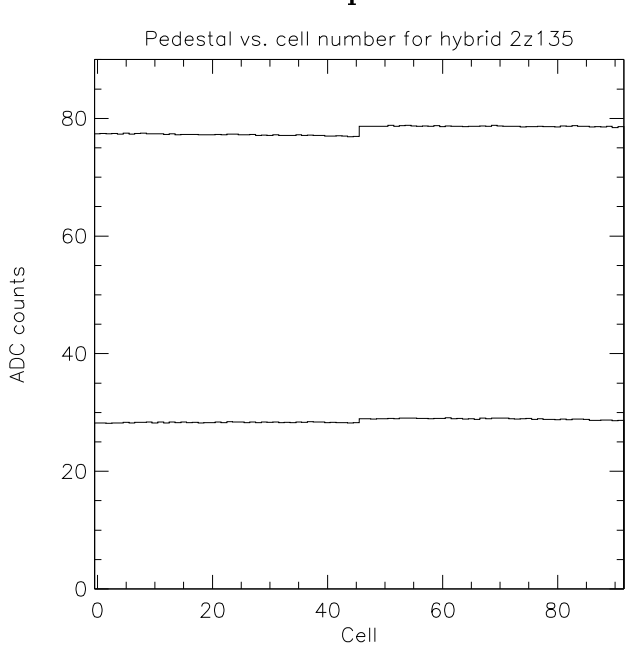

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

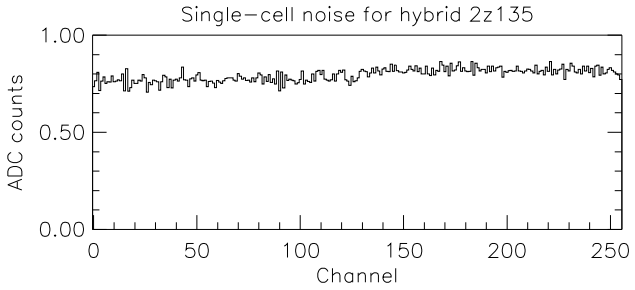

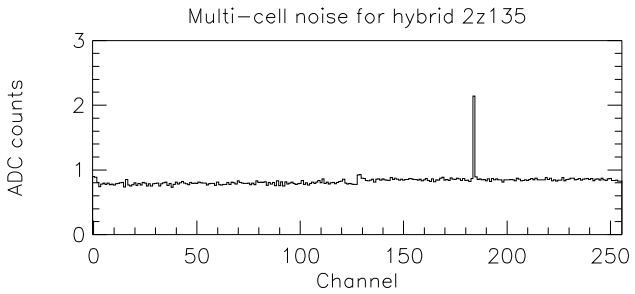

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

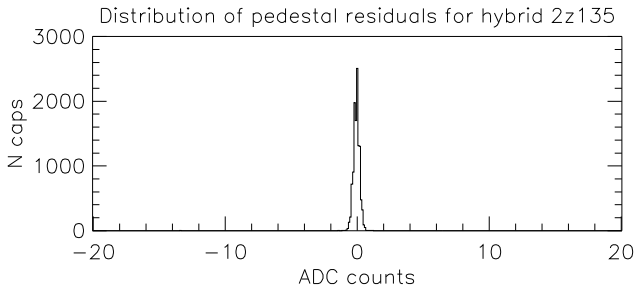

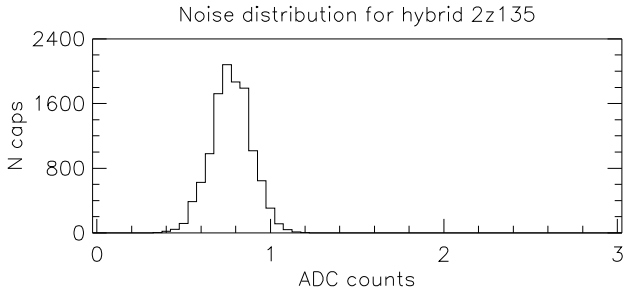

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
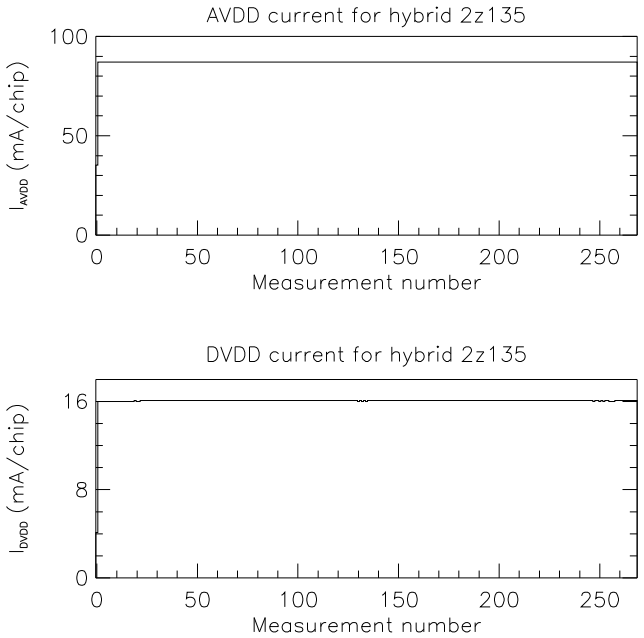
Supply Currents During Burn-in