# Hybrid 4z219 Traveler

March 29, 2000

## 1 Connectivity

Repairs on shorts:
High resistance HV short to gnd in hybrid. Fixed by:

- removing 0 Ohm resistors from R5A and R5B on right side
- isolating buried HV path from right to left sides by scratching surface gold trace between the HV via (to buried HV jumper trace) and 10k Ohm resistor in R5A on left side
- adding a wire from HV+ solder pad on R5A on left side to R5A on right side

Fixes for opens:

## 2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 4Z219 has die: 160-038 160-046 160-055 160-063

## 3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 4z219 classification info. Created 10:49:16 02/24/00

Hybrid 4z219 quality: good
Chip classification: good good good good
Bad channels: none
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 25.6 26.3 31.7 30.6
```

# 4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

# 5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

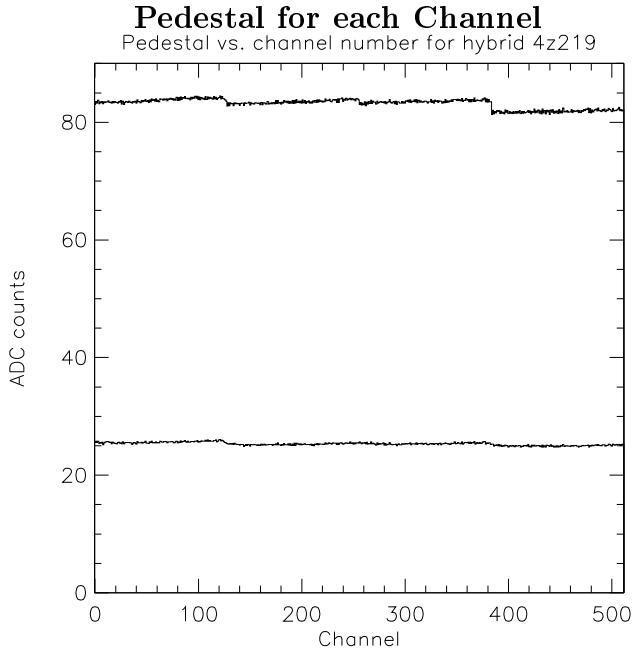


The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

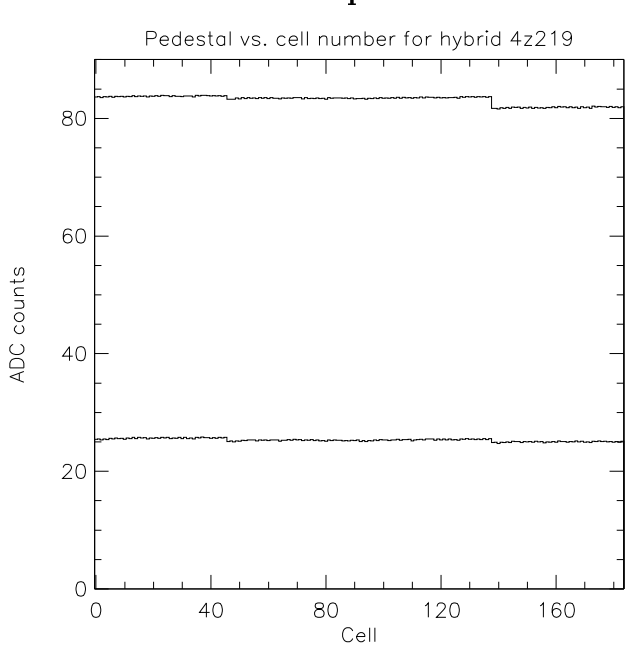

# 6 Noise

The following plots show the single-cell and multi-cell RMS noise:

**RMS Noise**

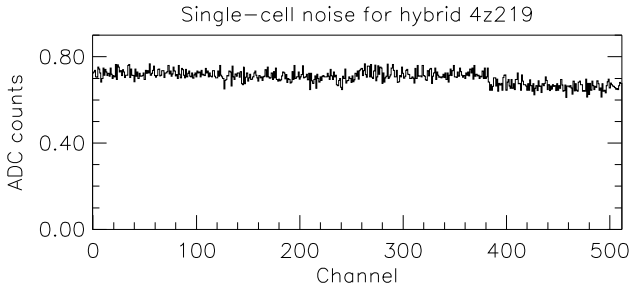


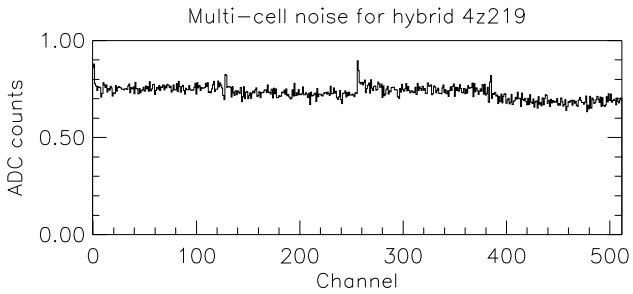


The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

**Distribution of Pedestals and Noise**

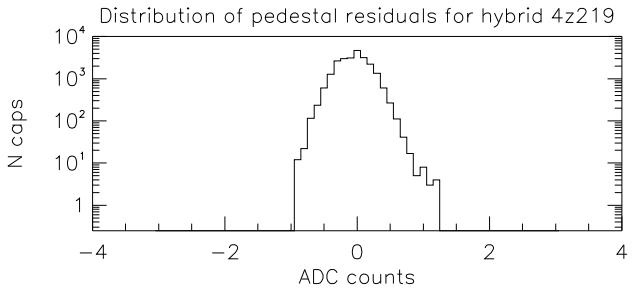


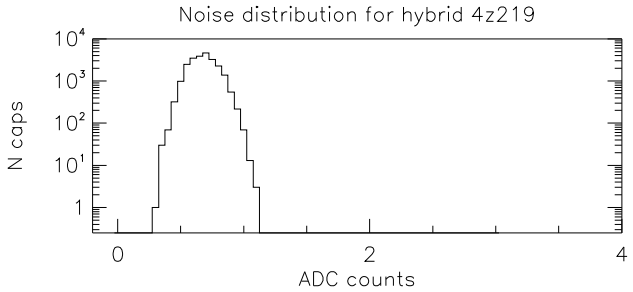

# 7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
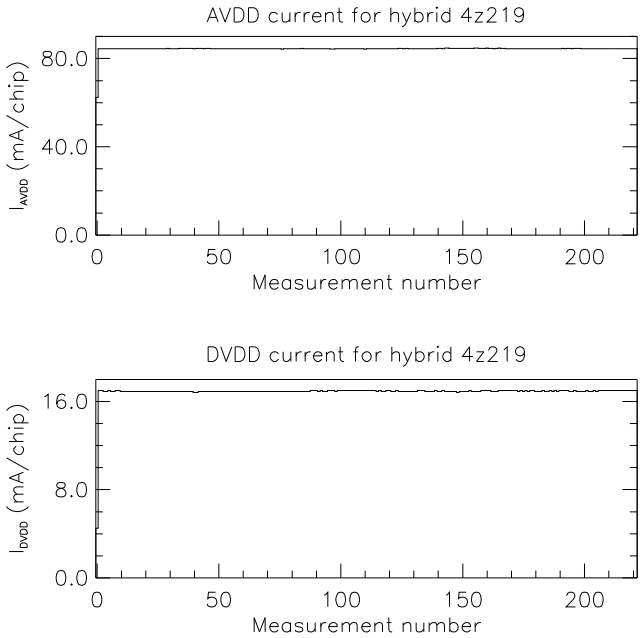
**Supply Currents During Burn-in**