Hybrid 5z108 Traveler

May 1, 2000

1 Connectivity

Repairs on shorts: Islope to Cal/SR on chip 4 fixed by moving Islope resistor to spare site.

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 5Z108 has die: 180-048 180-049 180-050 180-051 180-052

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 5z108 classification info. Created 08:58:36 05/01/00

Hybrid 5z108 quality: fair
Chip classification: fair good good good good
Bad channels: none
Bad cells: none
Random bad capacitors (chip-cell-channel): 0-38-75
Channels at pedestal needed for DCMS: 32.6 32.5 34.7 32.5 32.7
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

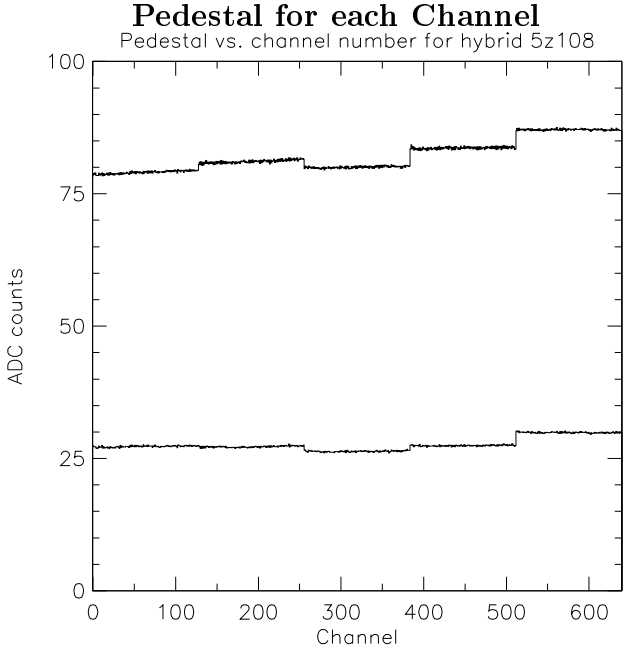

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

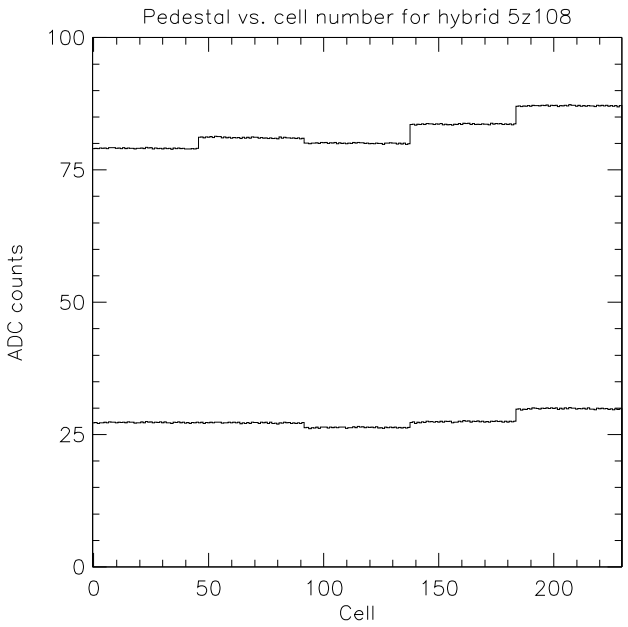

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

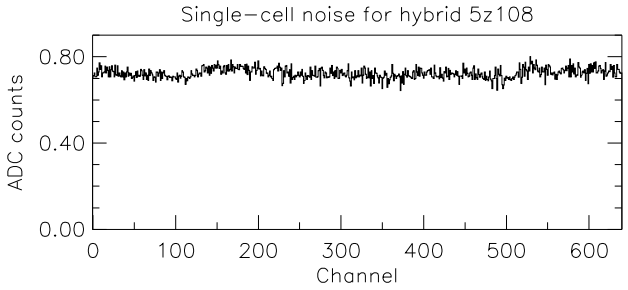

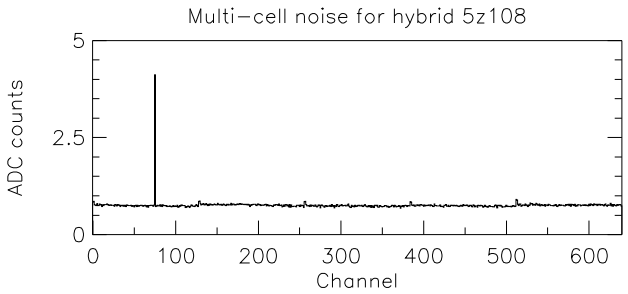

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

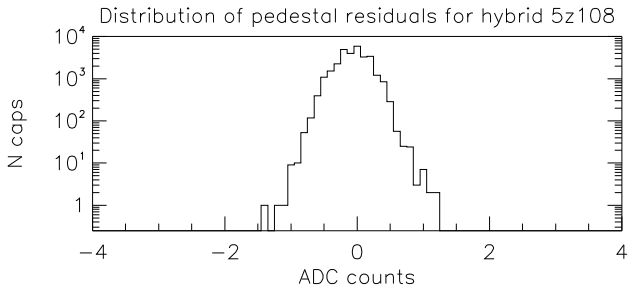

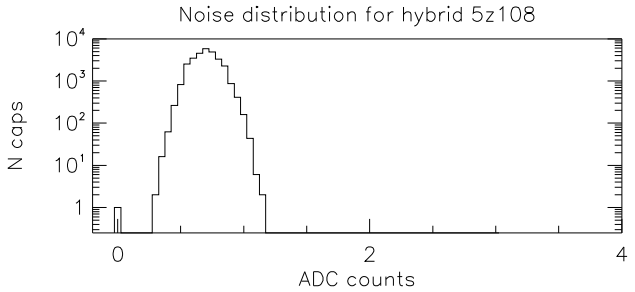

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
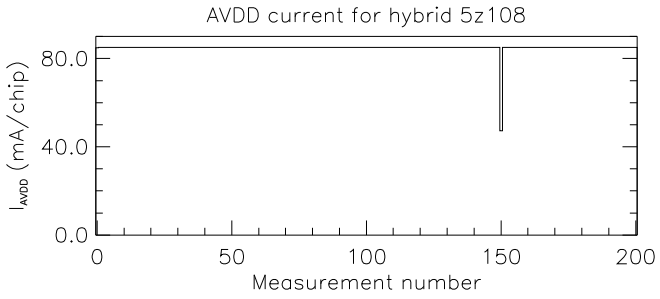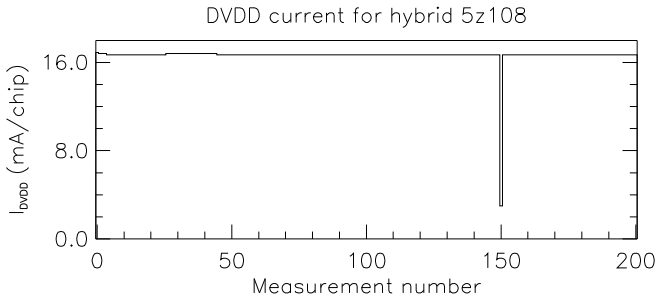
Supply Currents During Burn-in