Hybrid 5z118 Traveler

March 2, 2000

1 Connectivity

Repairs on shorts: Bus2B shorted to A2. Fixed by scraping a fat trace on the surface which is not used anyway.

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 5Z118 has die: 095-030 095-031 095-034 095-035 095-036

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 5z118 classification info. Created 18:41:12 12/03/99

Hybrid 5z118 quality: good
Chip classification: good good good good good
Bad channels: none
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 36.6 34.6 38.6 34.7 33.6
```

4 Comments

Has redundant FE DVDD and DGND wirebonds. HV tested. Encapsulated.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

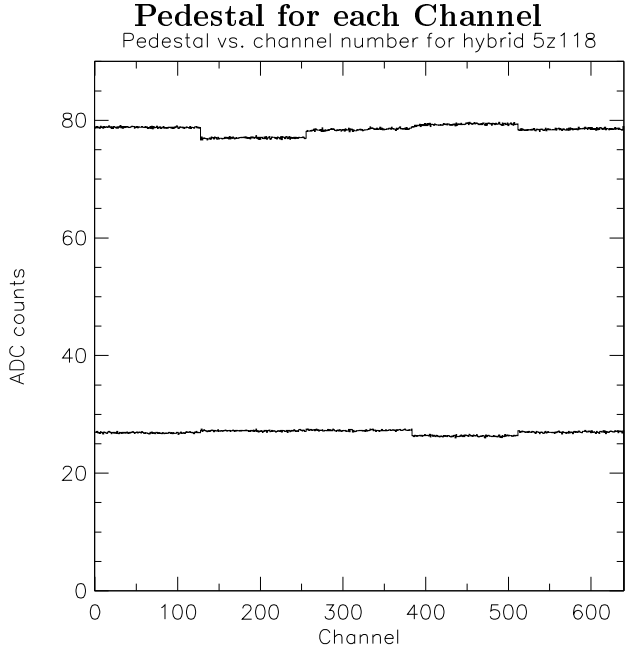

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

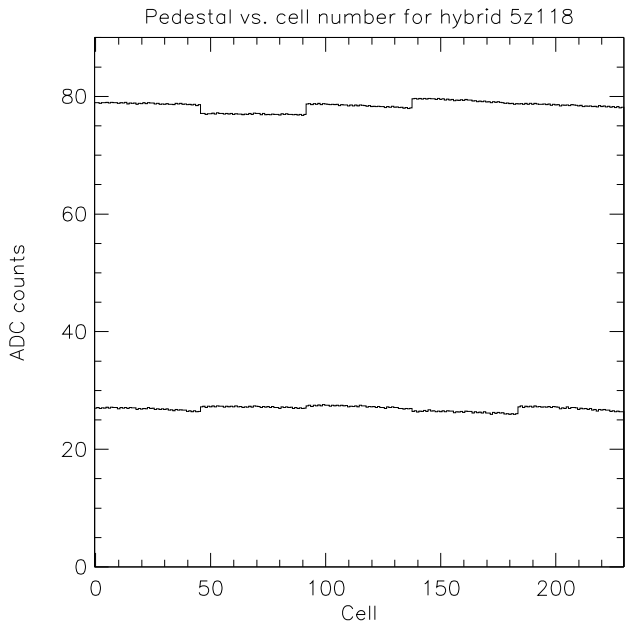

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

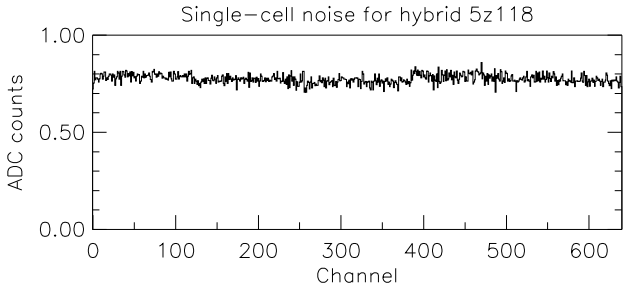

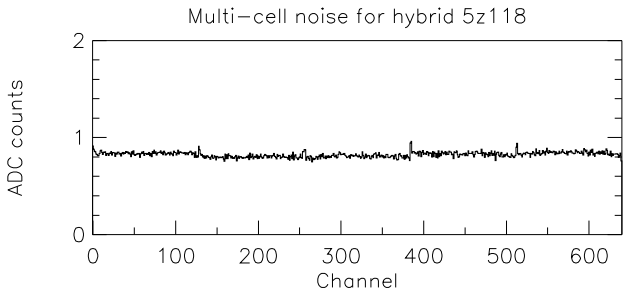

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

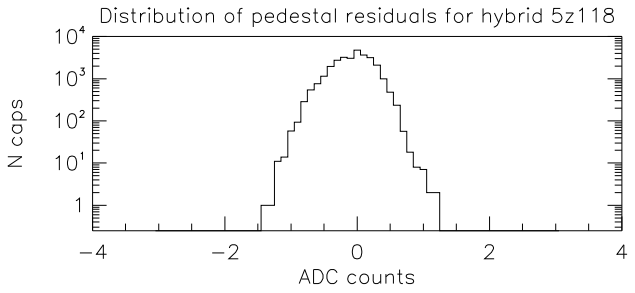

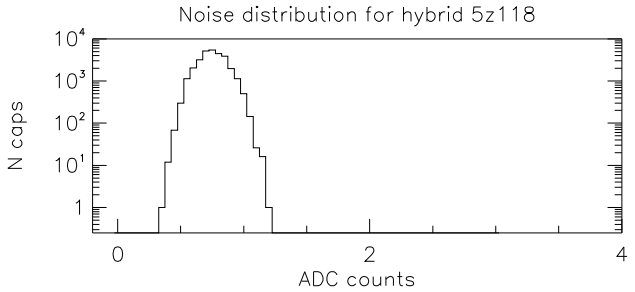

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
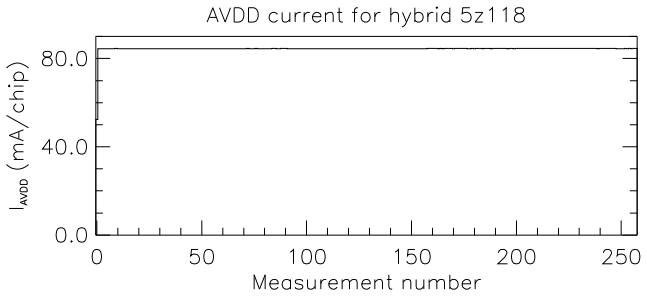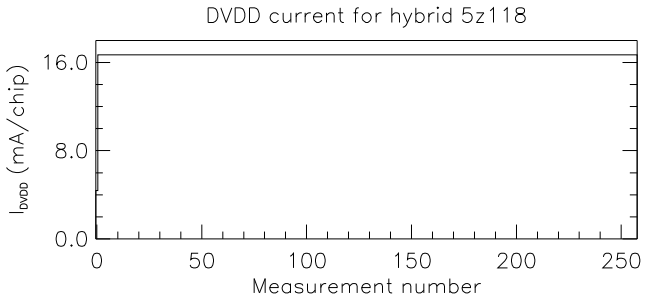
Supply Currents During Burn-in