Hybrid 3z134 Traveler

December 17, 1999

1 Connectivity

Repairs on shorts:

Fixes for opens:
HV open on hybrid fixed with wire from HV resistor to HV capacitor.
OBDVH open on Chip 3. Fixed–jumped from Chip 2.

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 3Z134 has die: 025-021 025-022 025-024

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 3z134 classification info. Created 18:01:57 12/16/99

Hybrid 3z134 quality: good
Chip classification: good good good
Bad channels: none
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 31.6 32.6 28.7
```

4 Comments

Has Au finger DVDD and DGND wirebonds.
HV Test.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

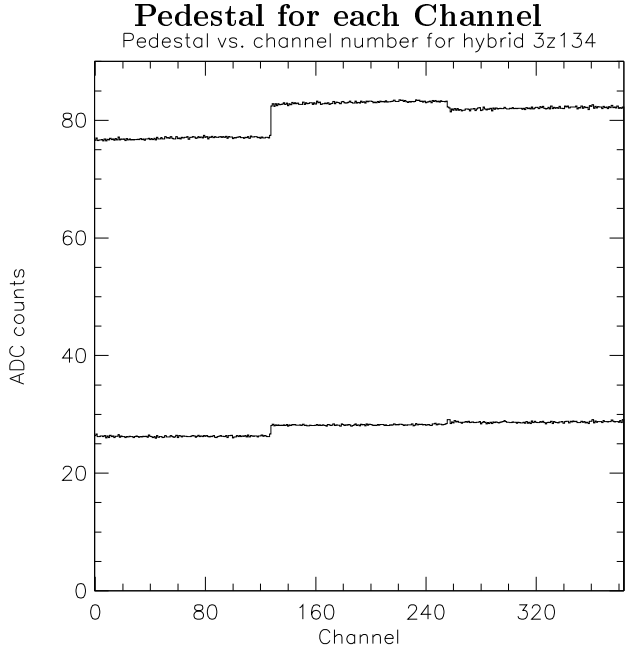

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

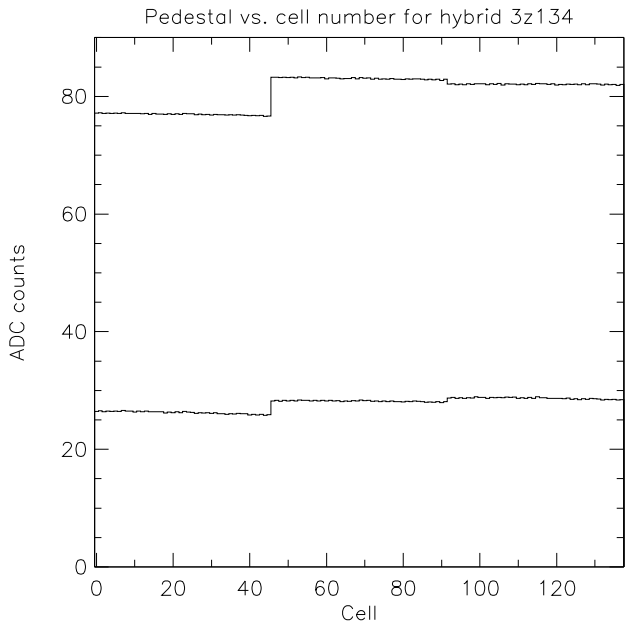

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

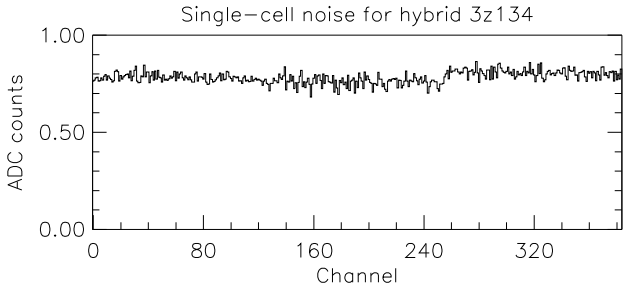

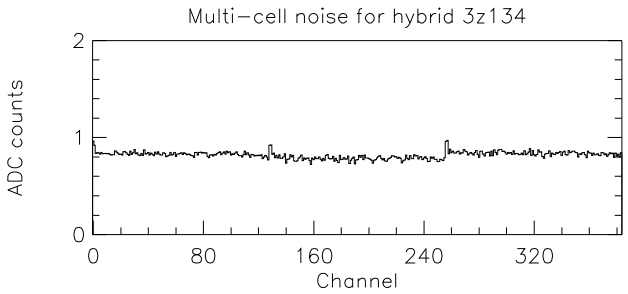

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

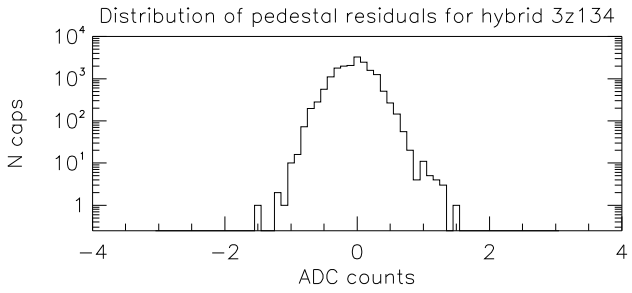

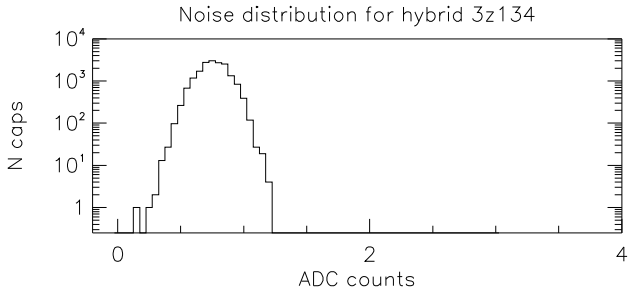

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
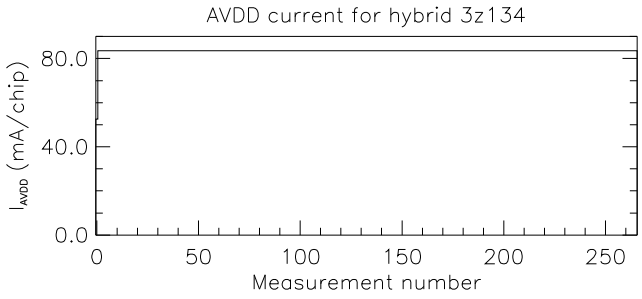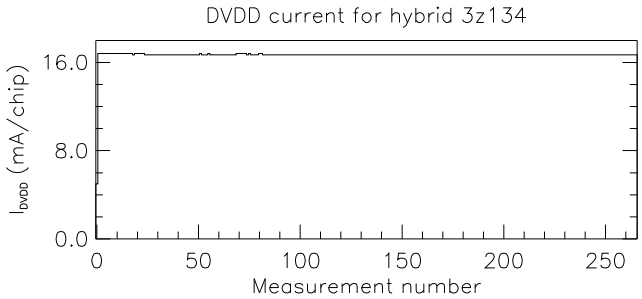
Supply Currents During Burn-in