Hybrid 3z156 Traveler

December 21, 1999

1 Connectivity

Repairs on shorts:

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 3Z156 has die: 103-040 103-047 103-049

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 3z156 classification info. Created 18:03:47 11/19/99

Hybrid 3z156 quality: fair
Chip classification: good fair good
Bad channels (chip-channel): 1-100 1-101
Bad cells: none
Random bad capacitors (chip-cell-channel): 1-10-100 1-12-100 1-22-100
   1-34-100 1-40-14 1-5-100 1-6-100 1-8-100
Channels at pedestal needed for DCMS: 34.6 27.6 35.7
```

4 Comments

Has redundant FE DVDD and DGND wirebonds.
HV Test.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

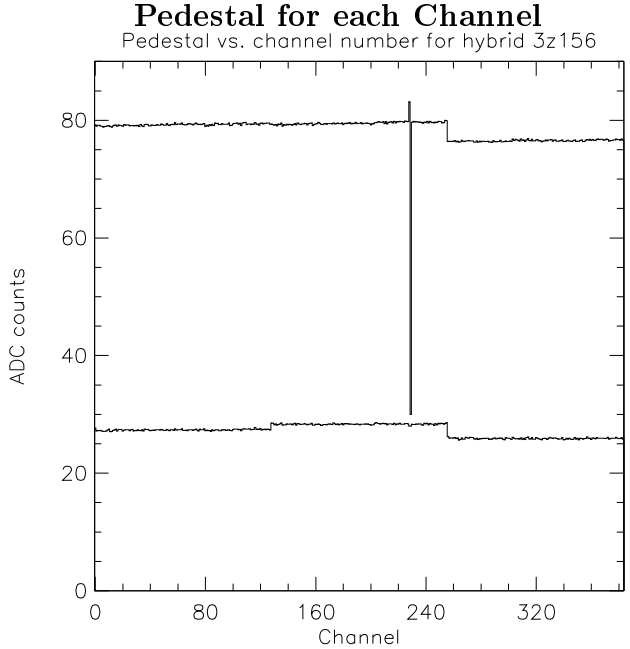

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

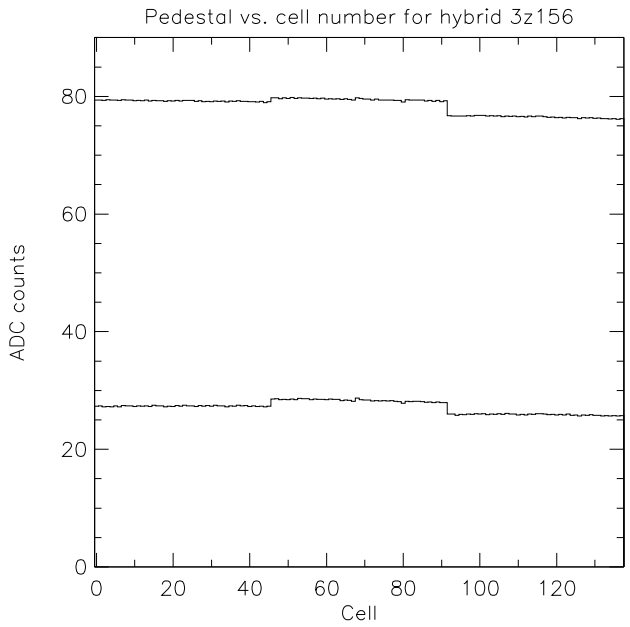

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

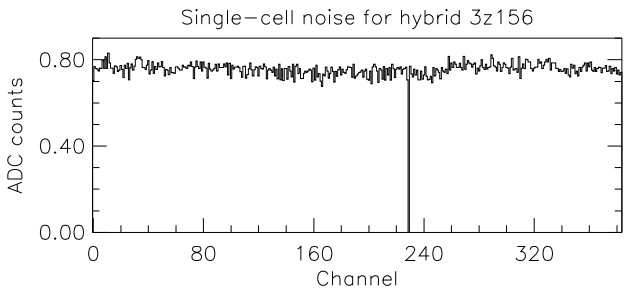

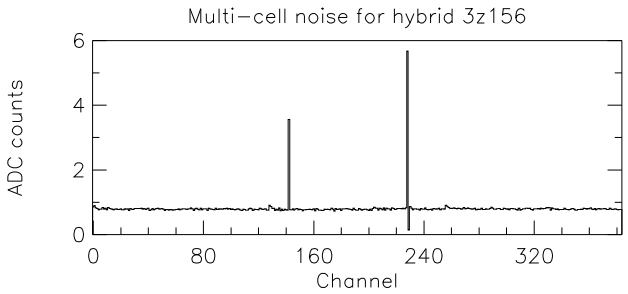

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

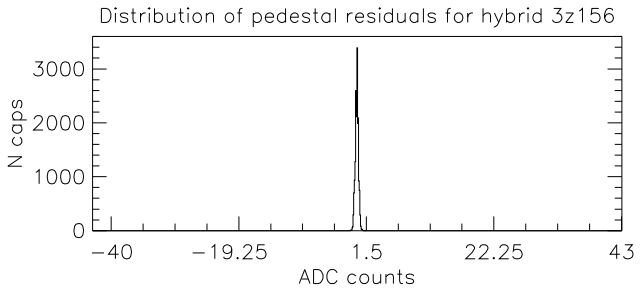

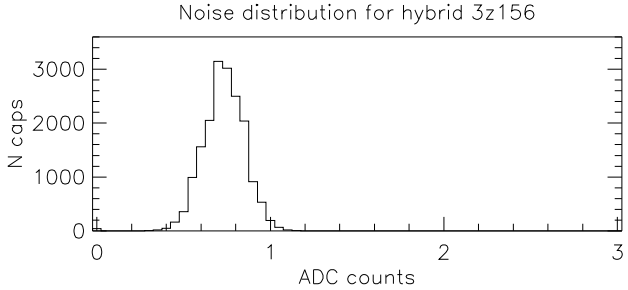

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
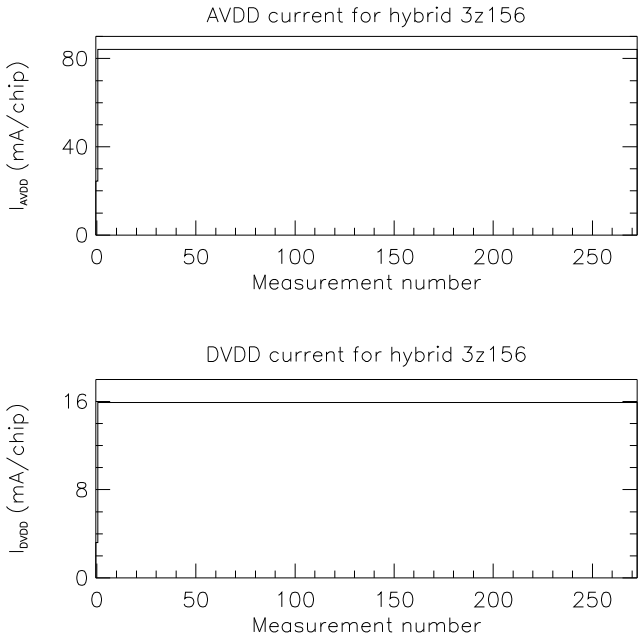
Supply Currents During Burn-in