Hybrid 5p105 Traveler

June 9, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 5P105 has die: 217-119 217-123 205-002 205-008 205-009

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 5p105 classification info. Created 16:46:26 06/09/00

Hybrid 5p105 quality: fair
Chip classification: fair fair good fair good
Bad channels (chip-channel): 0-3 0-101 1-66
Bad cells: none
Random bad capacitors (chip-cell-channel): 1-21-98 3-16-66 3-16-67
   3-17-67 3-29-67 3-3-67 3-5-67
Channels at pedestal needed for DCMS: 33.6 35.4 31.7 33.7 29.3
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

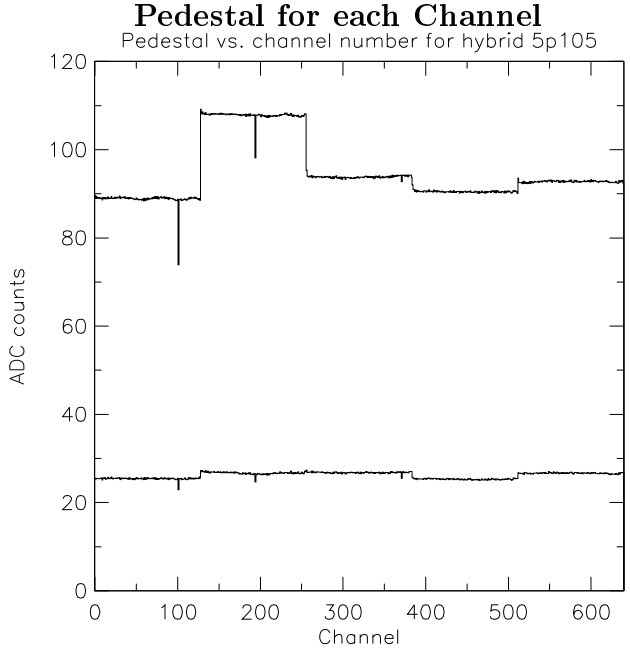

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

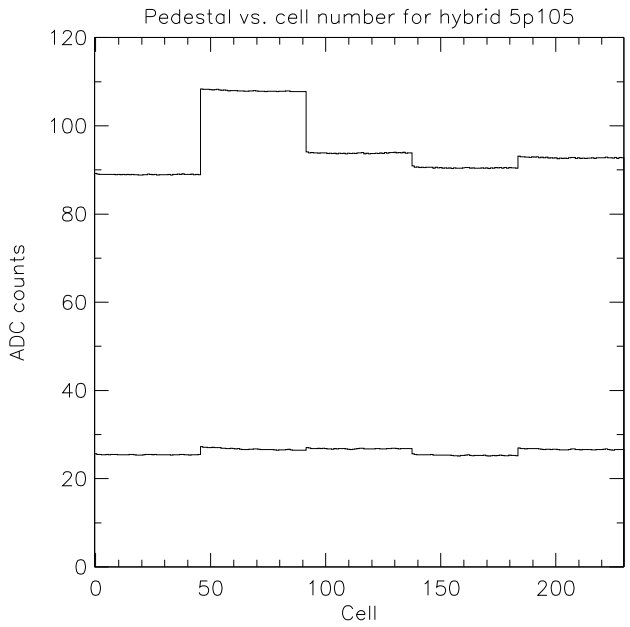

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

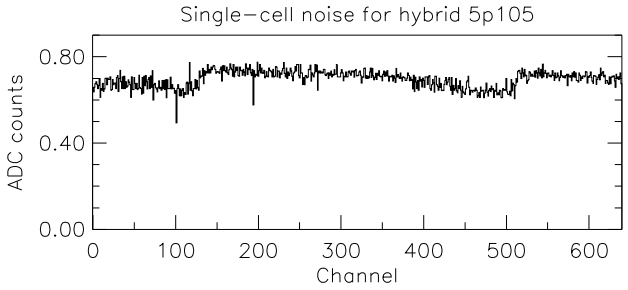

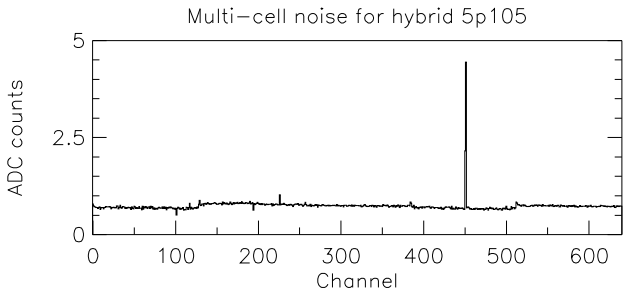

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

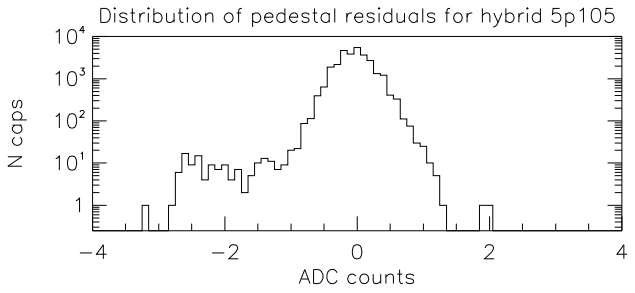

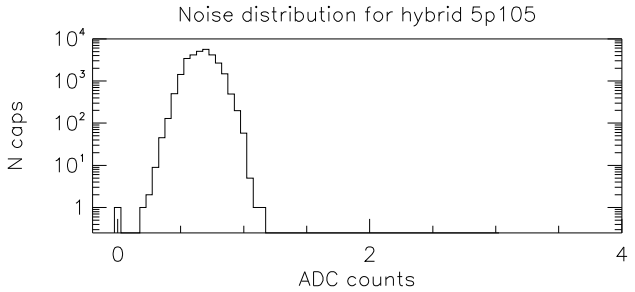

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
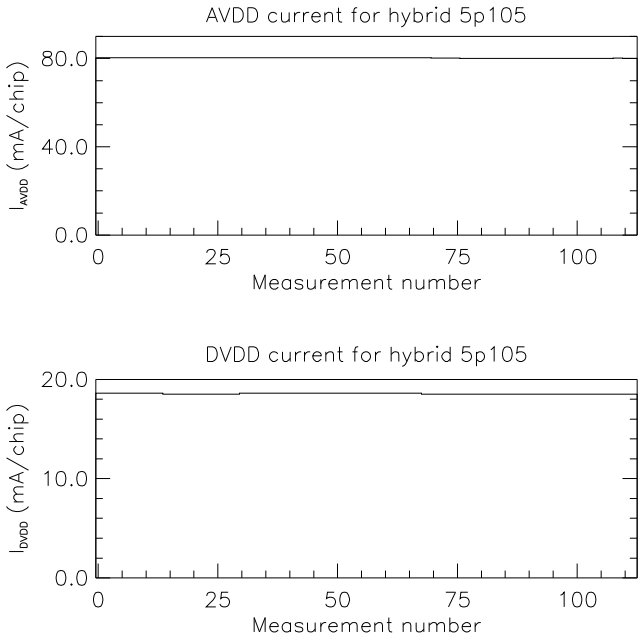
Supply Currents During Burn-in