Hybrid 5p9 Traveler

January 4, 2000

1 Connectivity

Repairs on shorts:

Fixes for opens:Bus3 open on chip 5 (known open). fixed with w/b jump.

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 5P9 has die: 034-002 034-003 034-005 034-007 034-010

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 5p9 classification info. Created 15:23:04 12/13/99

Hybrid 5p9 quality: fair
Chip classification: good good fair good good
Bad channels (chip-channel): 2-126
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 36.6 34.4 37.6 36.6 39.6
```

4 Comments

Has encapsulation.
Has automatic chip-to-chip wirebonds.
HV Test.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

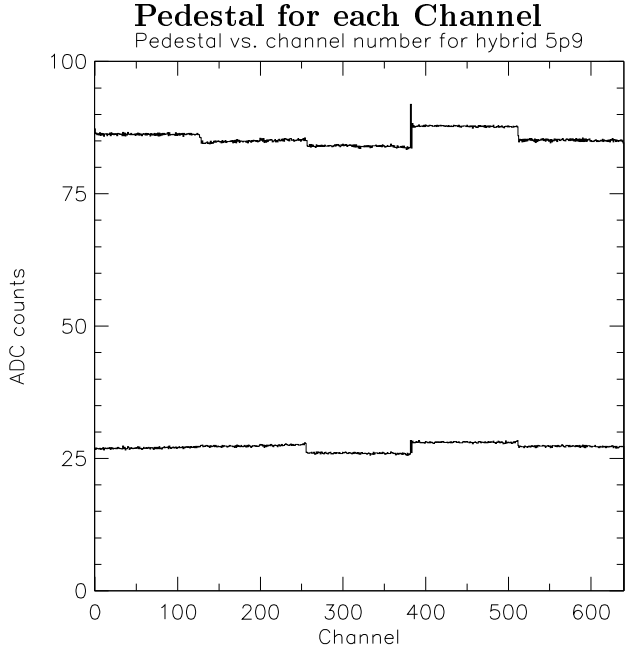

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

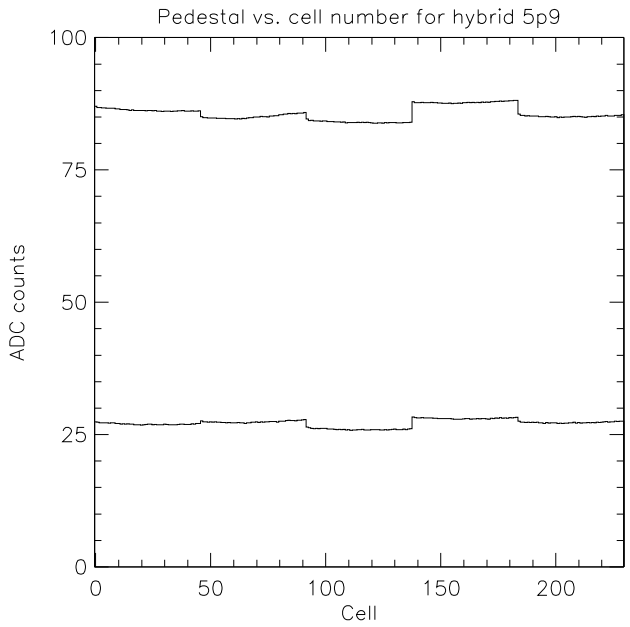

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

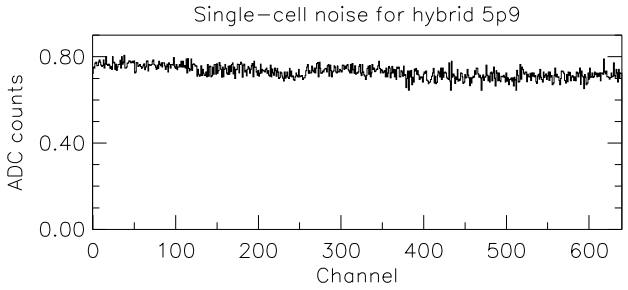

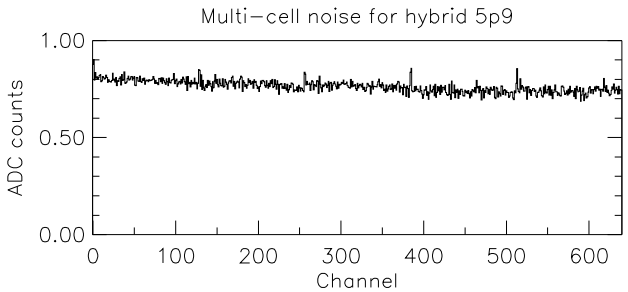

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

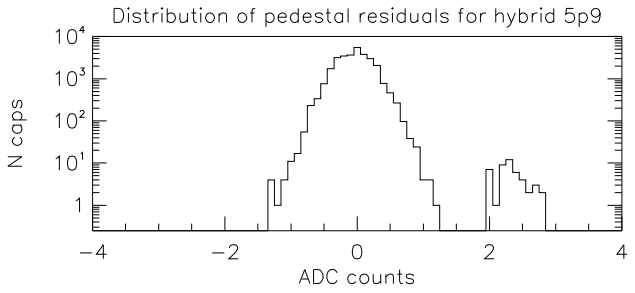

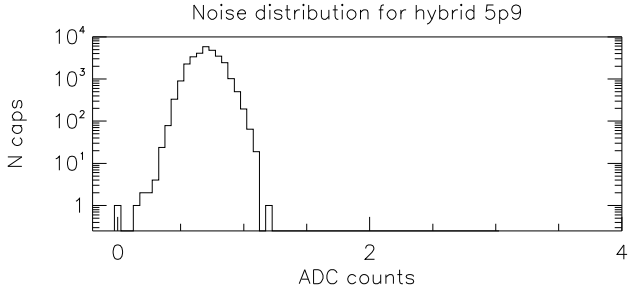

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
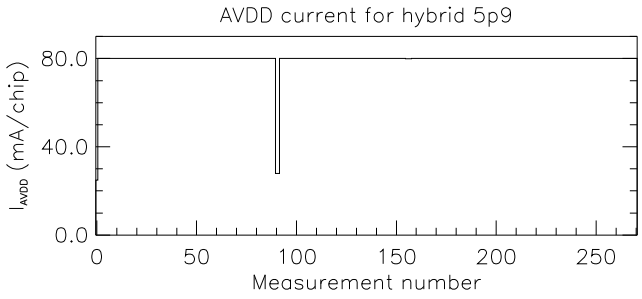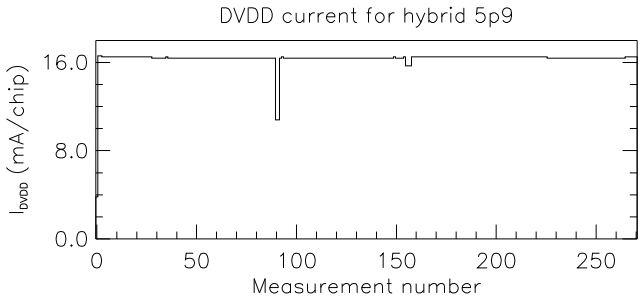
Supply Currents During Burn-in