Hybrid 5p94 Traveler

May 26, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 5P94 has die: 217-094 217-095 217-096 217-099 217-102

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 5p94 classification info. Created 14:03:47 05/25/00

Hybrid 5p94 quality: fair*
Chip classification: good fair fair fair fair*
Bad channels (chip-channel): 1-18 1-105 2-85 4-16 4-18
Bad cells: none
Random bad capacitors (chip-cell-channel): 1-10-104 1-12-104 1-14-104
   1-2-104 1-23-104 1-23-106 1-24-104 1-7-104 3-21-107 4-0-59 4-26-6
Channels at pedestal needed for DCMS: 33.6 34.7 32.6 33.7 36.5
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

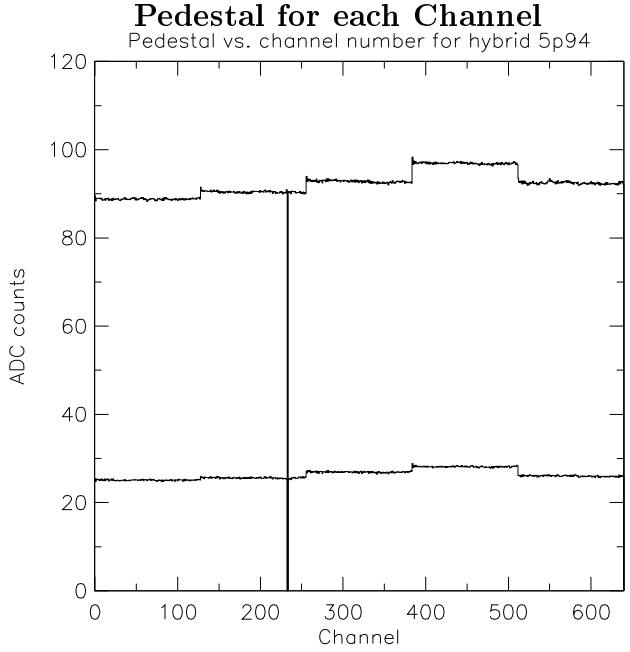

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

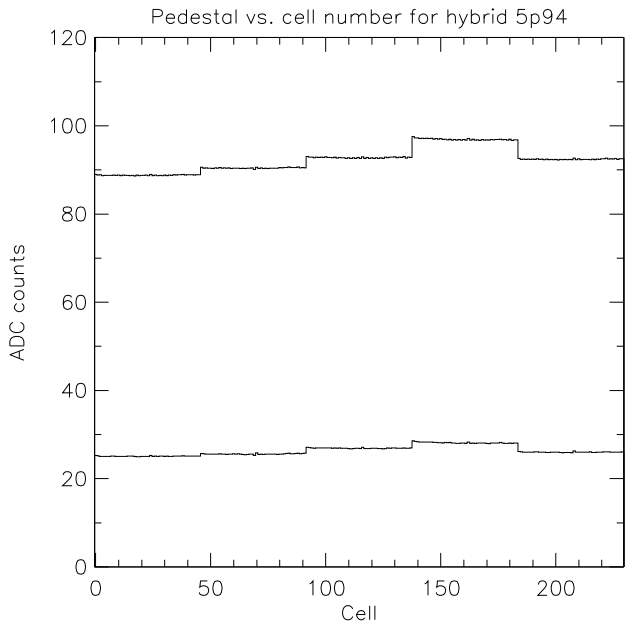

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

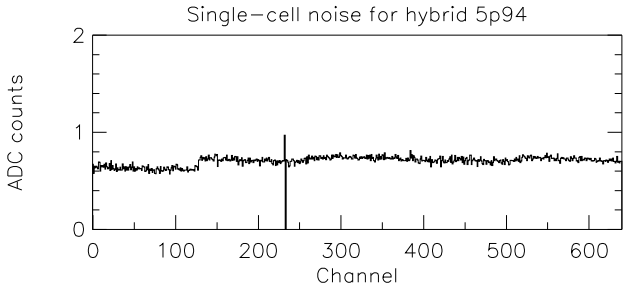

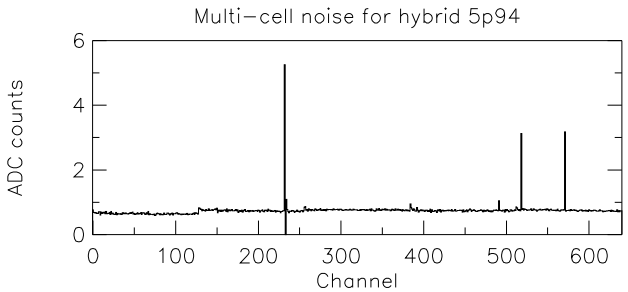

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

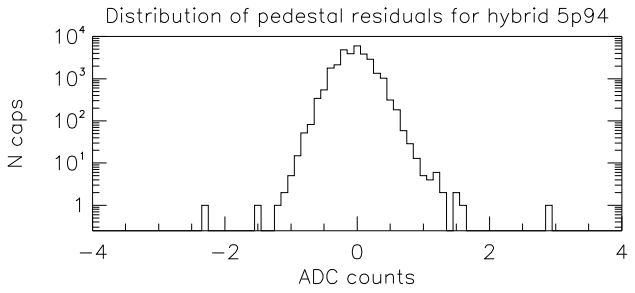

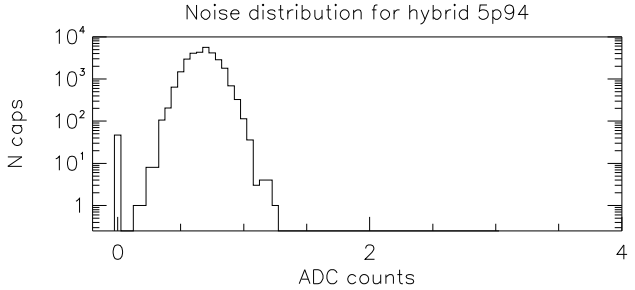

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
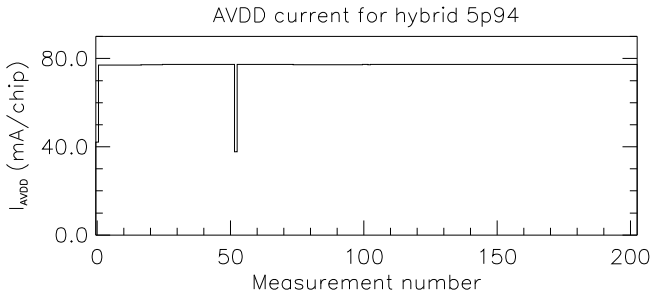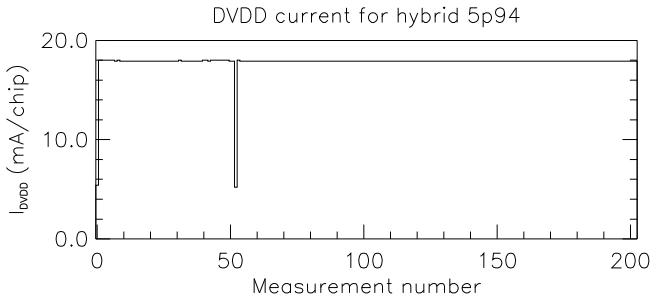
Supply Currents During Burn-in