Hybrid 5z95 Traveler

May 1, 2000

1 Connectivity

Repairs on shorts:
Low resistance HV short to AVDD2 on 2-chip side fixed by:

- scratching surface trace, hidden under the HV cap, which goes from HV cap to HV solder pad for (unused) HV- resistor
- adding wire from HV cap to spare trace near last finger
- wire bond HV from spare trace instead of HV wirebond trace.

Fixes for opens: FEMODE open to Chip 1. Fixed w/ wirebond.

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 5Z95 has die: 180-041 180-042 180-044 180-045 180-046

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 5z95 classification info. Created 08:52:22 05/01/00

Hybrid 5z95 quality: fair
Chip classification: good fair good good good
Bad channels (chip-channel): 1-45
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 32.7 30.7 32.5 31.7 31.3
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

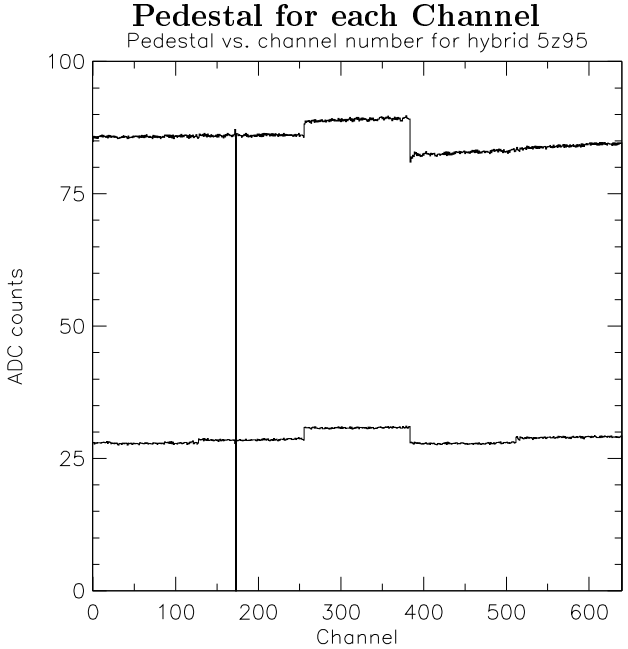

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

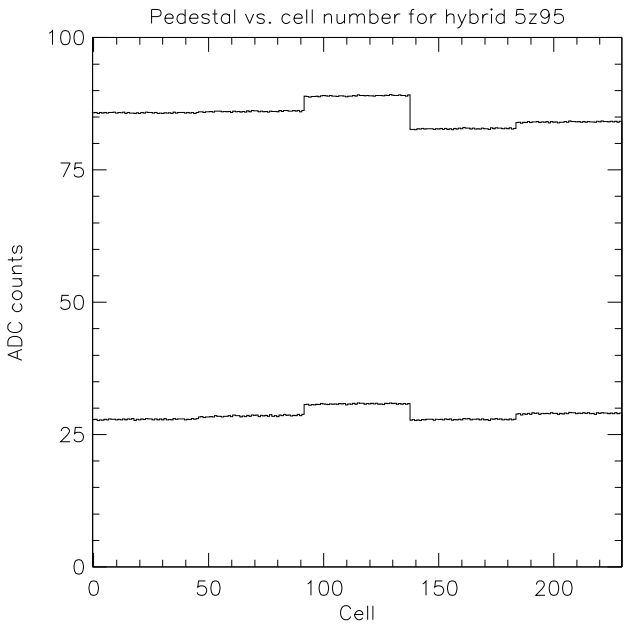

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

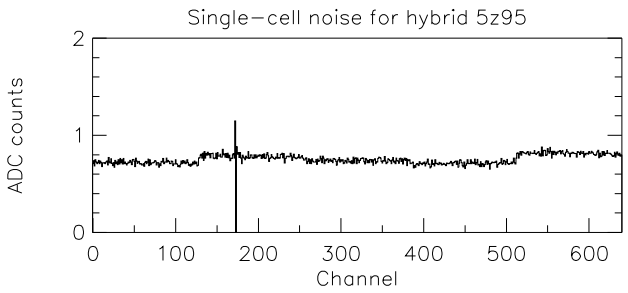

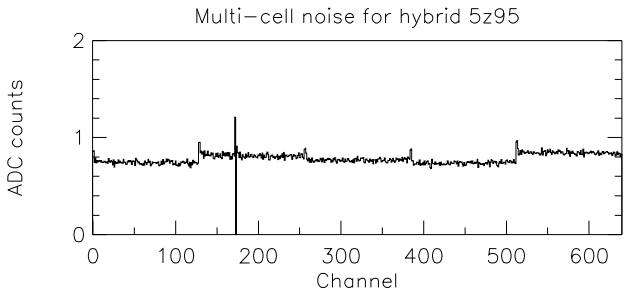

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

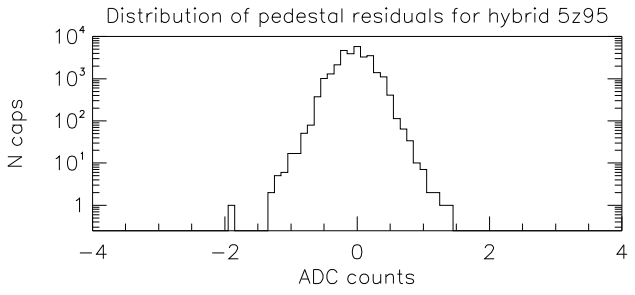

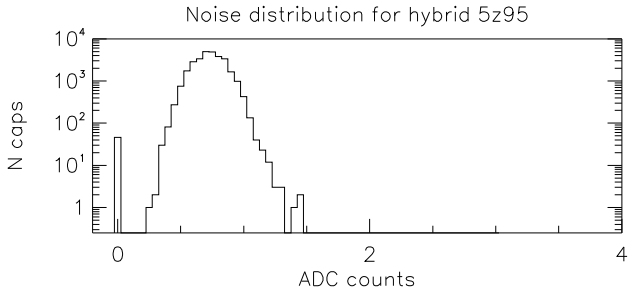

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
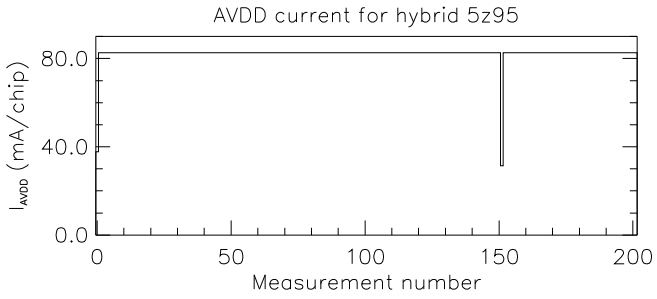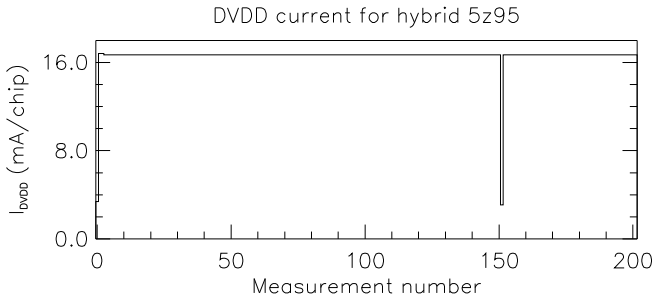
Supply Currents During Burn-in