Hybrid 6p115 Traveler

January 11, 2000

1 Connectivity

Repairs on shorts:

Fixes for opens:
Bus 3B open on chip 6 fixed with a w/b from chip 5.
Bus 4 open on chip 1 fixed with a w/b from chip 2.

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 6P115 has die: 194-009 194-010 194-012 194-013 194-015 194-017

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 6p115 classification info. Created 12:36:16 01/10/00

Hybrid 6p115 quality: fair
Chip classification: good fair good good fair fair
Bad channels (chip-channel): 1-17 1-117 4-116 5-57
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 29.8 33.6 34.6 33.6 29.6 28.6
```

4 Comments

Has Au DVDD, DGND bonds.
HV test.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

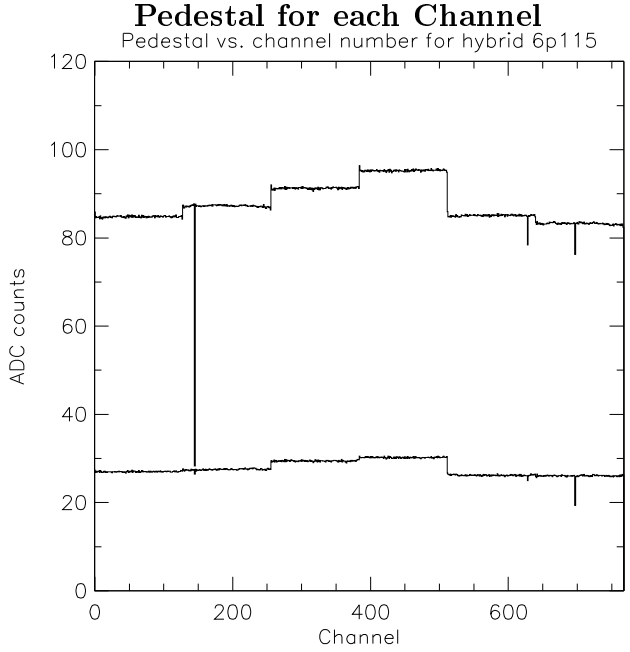

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

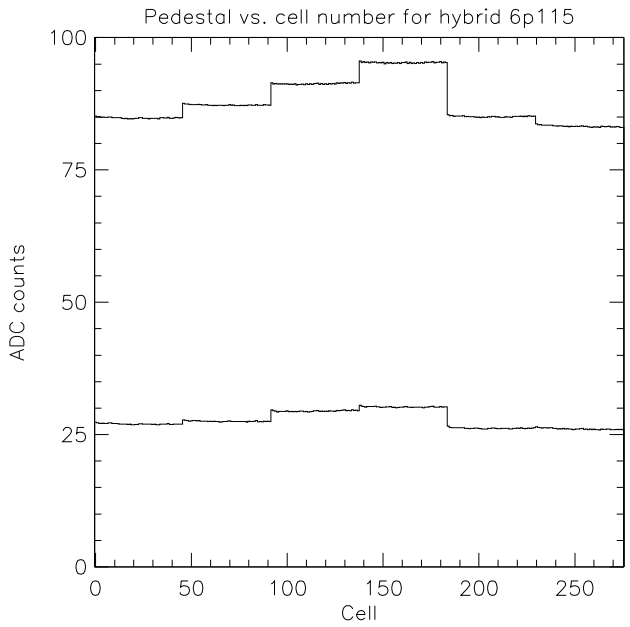

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

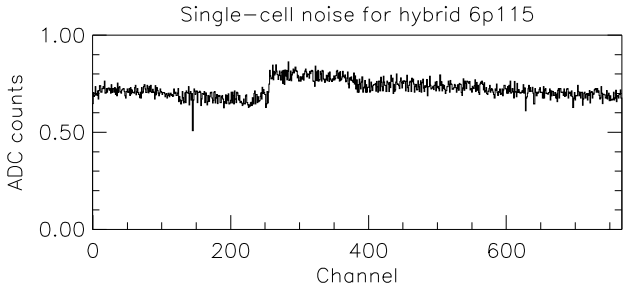

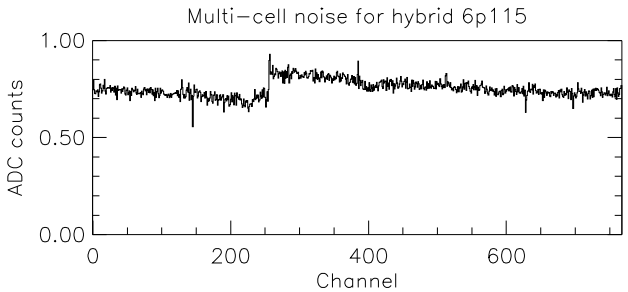

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

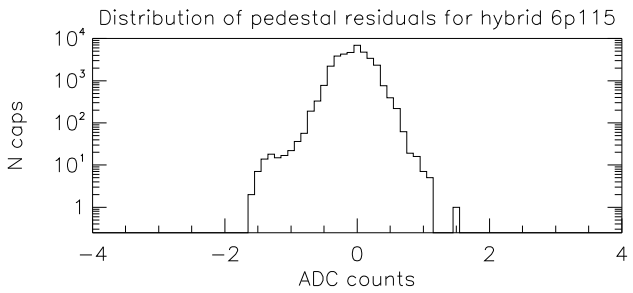

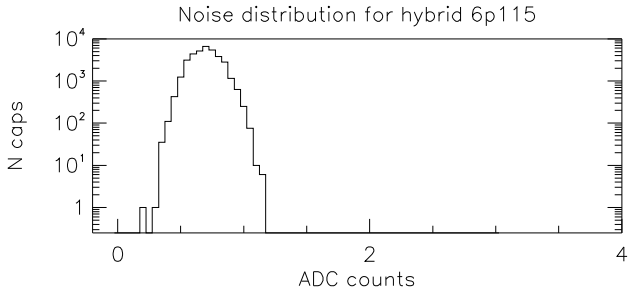

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
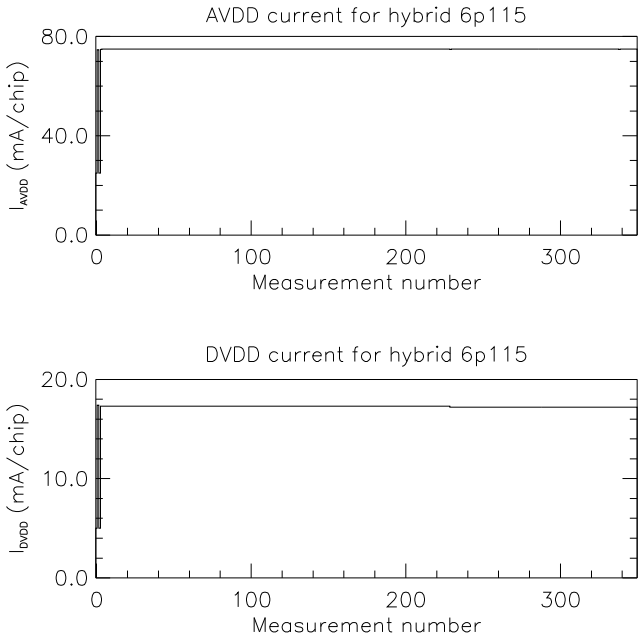
Supply Currents During Burn-in