Hybrid 7p142 Traveler

April 14, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 7P142 has die: 157-100 157-101 157-103 157-104 157-119 247-001 247-002

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 7p142 classification info. Created 10:04:51 04/10/00

Hybrid 7p142 quality: fair
Chip classification: good good good good good fair good
Bad channels (chip-channel): 5-127
Bad cells: none
Random bad capacitors (chip-cell-channel): 5-10-75 5-30-75 5-32-75
   5-34-75 5-43-74 5-43-75 5-44-75
Channels at pedestal needed for DCMS: 32.8 32.6 33.6 32.7 32.5 27.5 29.7
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested. Vcal gain on hybrid is low but acceptable.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

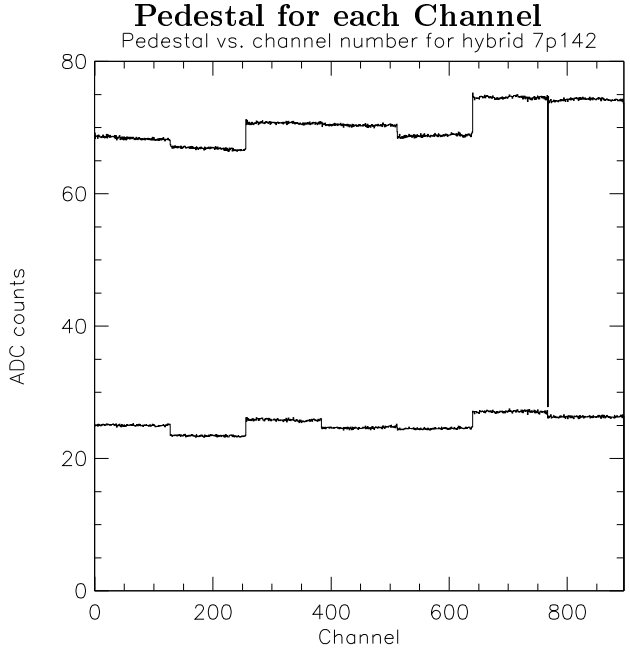

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

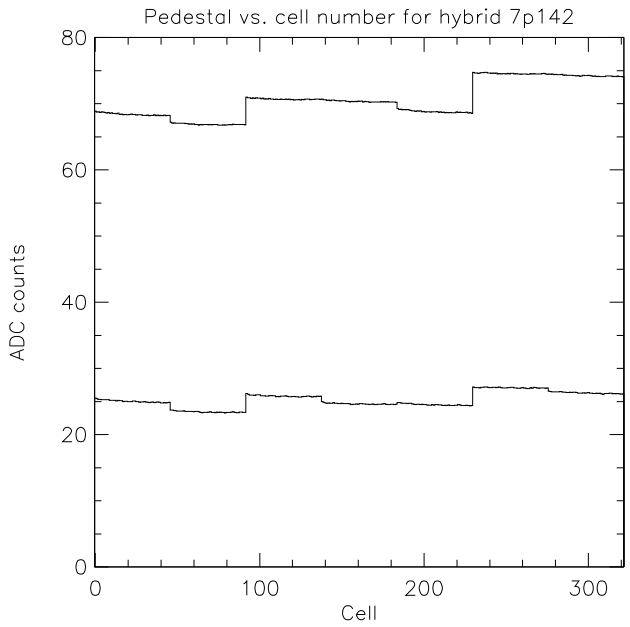

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

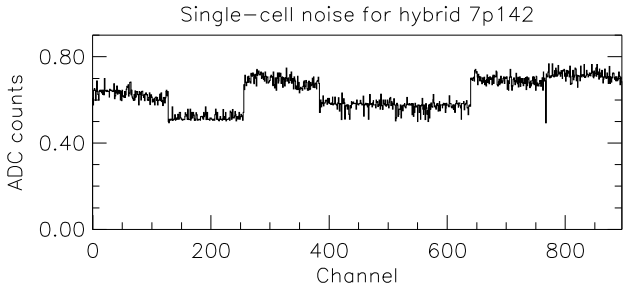

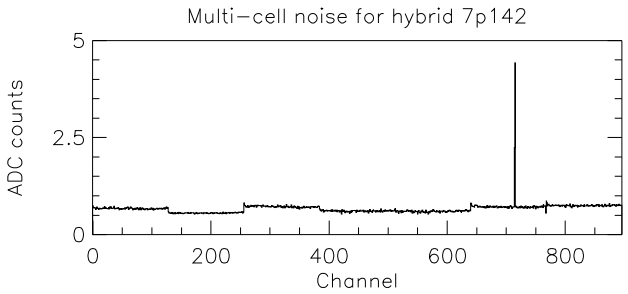

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

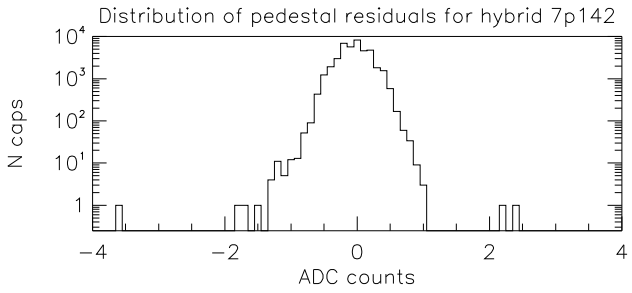

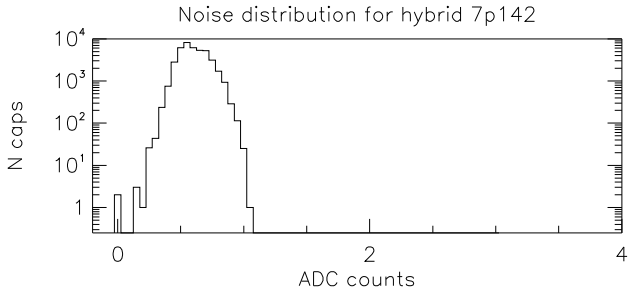

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
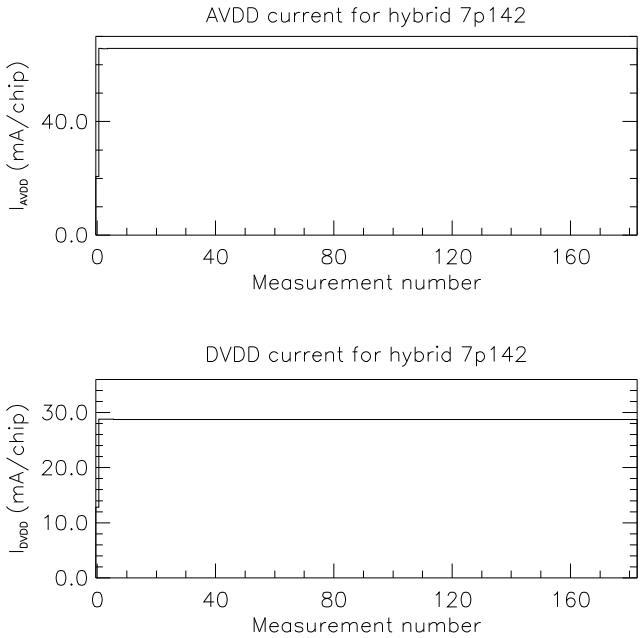
Supply Currents During Burn-in