Hybrid 7p172 Traveler

February 11, 2000

1 Connectivity

Repairs on shorts:

Fixes for opens: AGND on finger 1 fixed with silver epoxy

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 7P172 has die: 175-058 175-059 175-061 175-062 175-063 175-064 175-065

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 7p172 classification info. Created 11:04:38 02/11/00

Hybrid 7p172 quality: fair
Chip classification: good good good fair fair good fair
Bad channels: none
Bad cells: none
Random bad capacitors (chip-cell-channel): 3-27-77 3-35-49 3-43-95
   4-36-109 4-42-115 6-33-6 6-36-99 6-39-125 6-41-111
Channels at pedestal needed for DCMS: 35.6 33.7 31.7 35.6 34.7 35.7 36.7
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

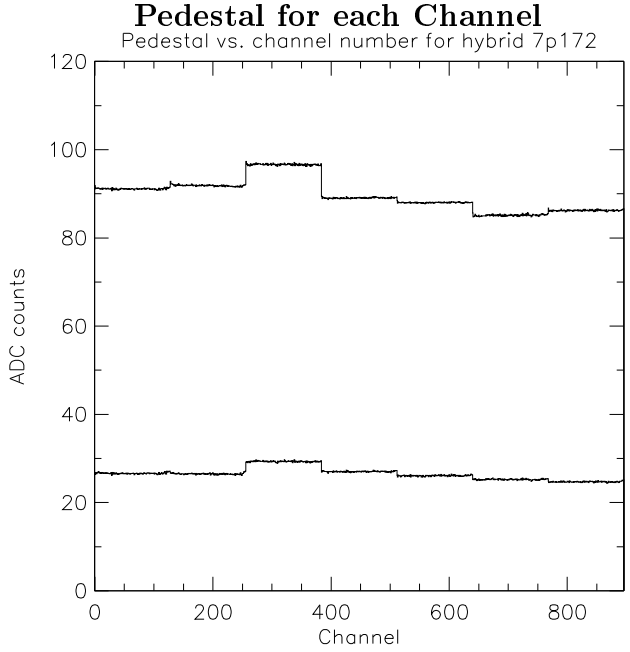

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

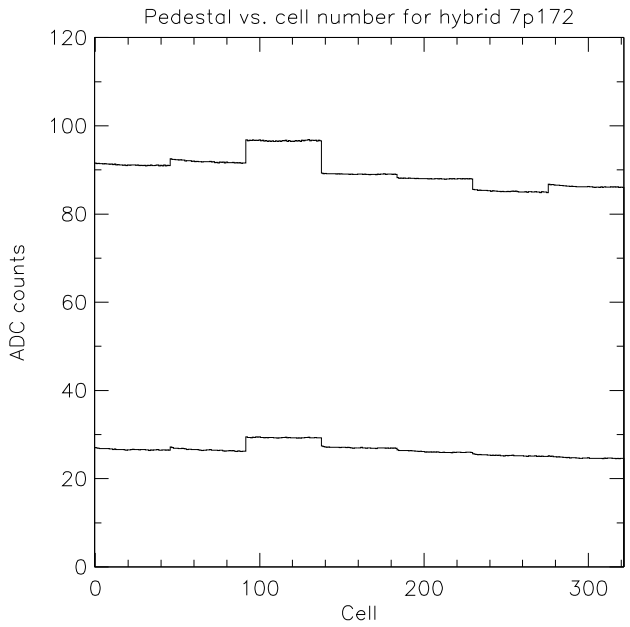

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

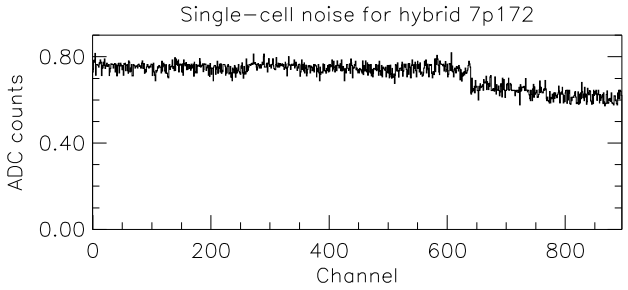

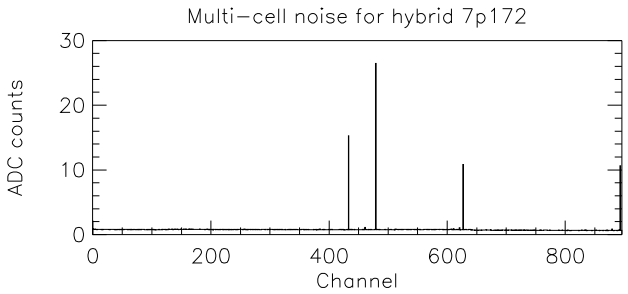

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

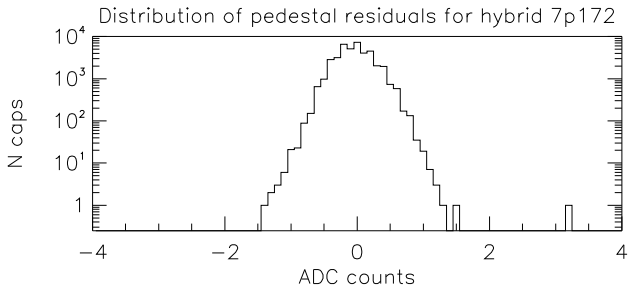

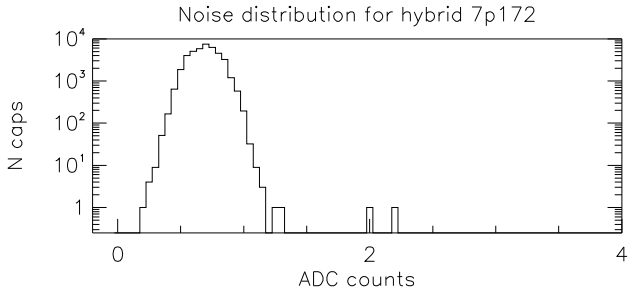

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
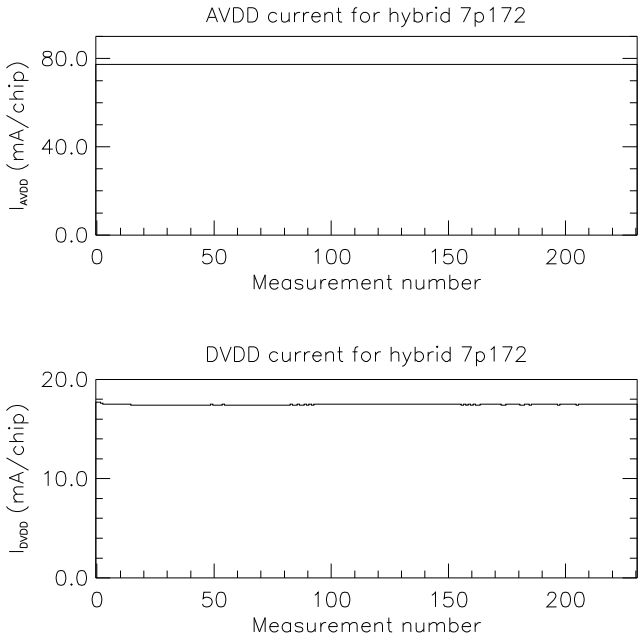
Supply Currents During Burn-in