Hybrid 7p71 Traveler

May 17, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 7P71 has die: 151-121 151-122 151-123 151-124 151-125 151-129 151-131

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 7p71 classification info. Created 10:49:03 05/17/00

Hybrid 7p71 quality: fair
Chip classification: fair good good good good good good
Bad channels: none
Bad cells: none
Random bad capacitors (chip-cell-channel): 0-18-116 0-18-117 0-31-117
   0-5-117 0-7-117
Channels at pedestal needed for DCMS: 32.7 31.7 33.7 34.6 33.7 32.5 32.6
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

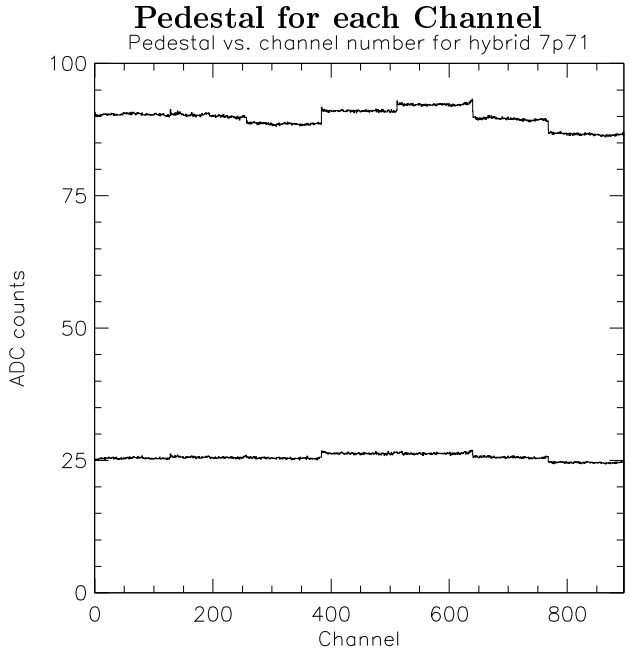

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

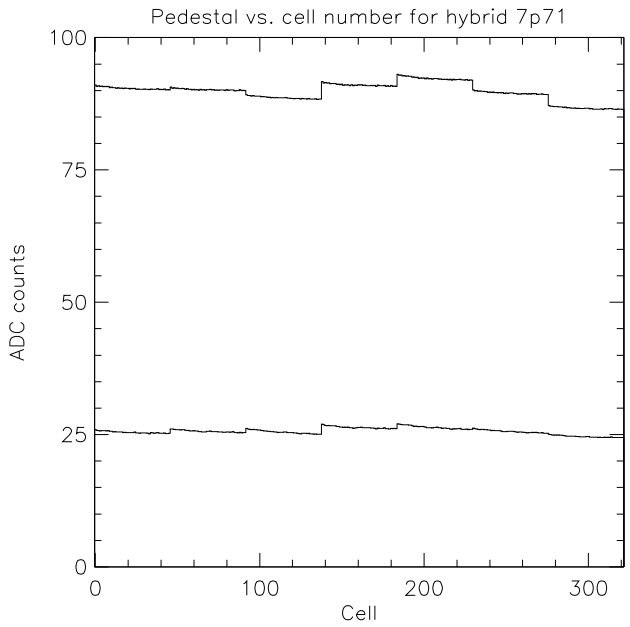

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

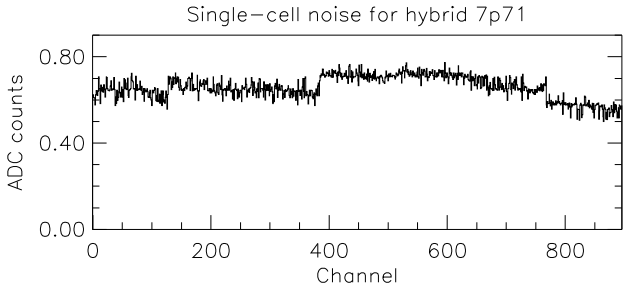

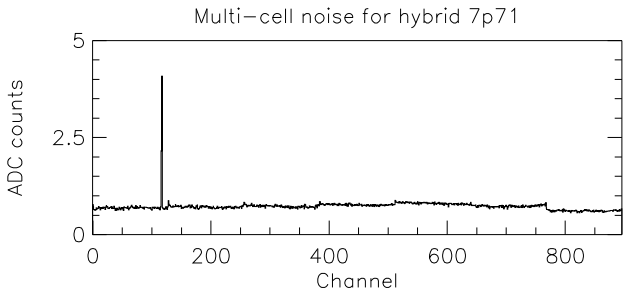

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

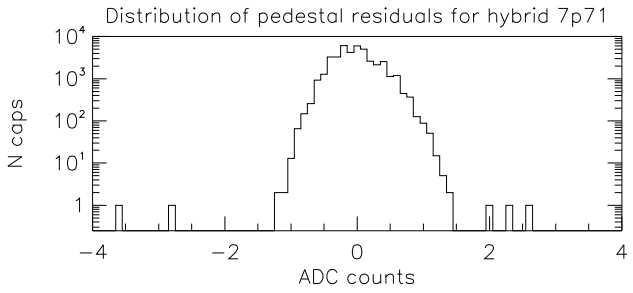

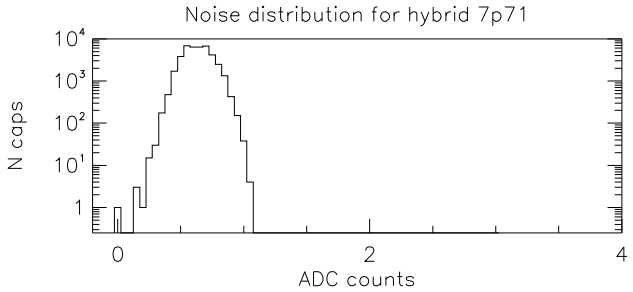

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
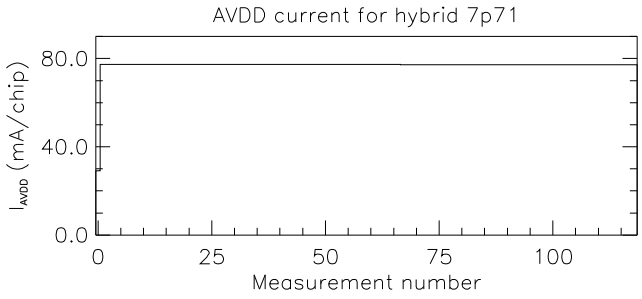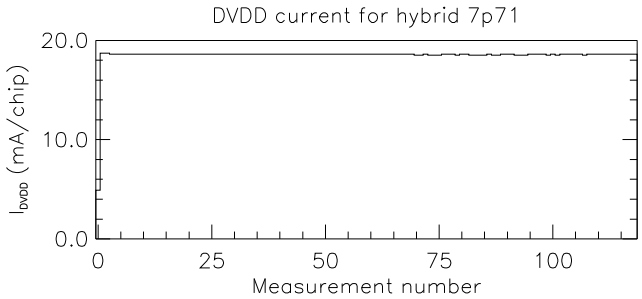
Supply Currents During Burn-in