Hybrid 7z35 Traveler

June 19, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens: HV with soldered wire.

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 7Z35 has die: 241-034 224-046 241-044 241-052 241-053 241-054 241-061

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 7z35 classification info. Created 08:46:02 06/08/00

Hybrid 7z35 quality: fair*
Chip classification: good fair fair* good good fair fair
Bad channels (chip-channel): 1-117 1-123 2-19 2-98 2-116 5-51 6-37
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 30.7 30.4 30.5 31.7 32.6 30.8 31.6
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

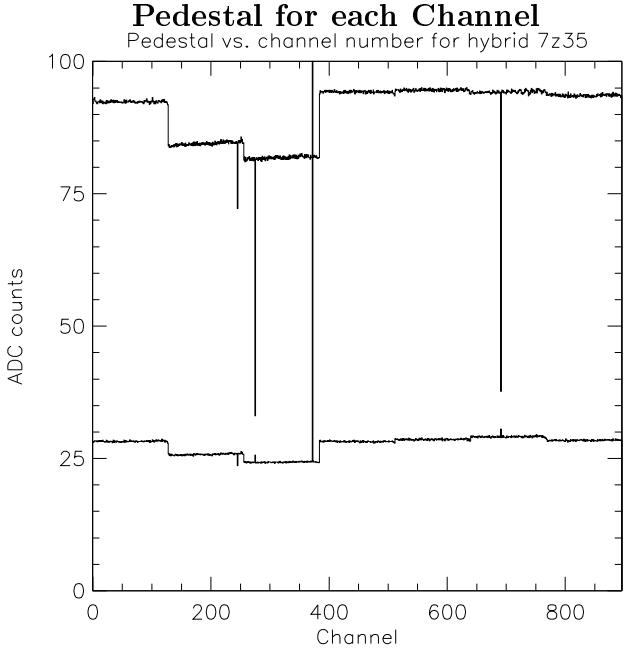

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

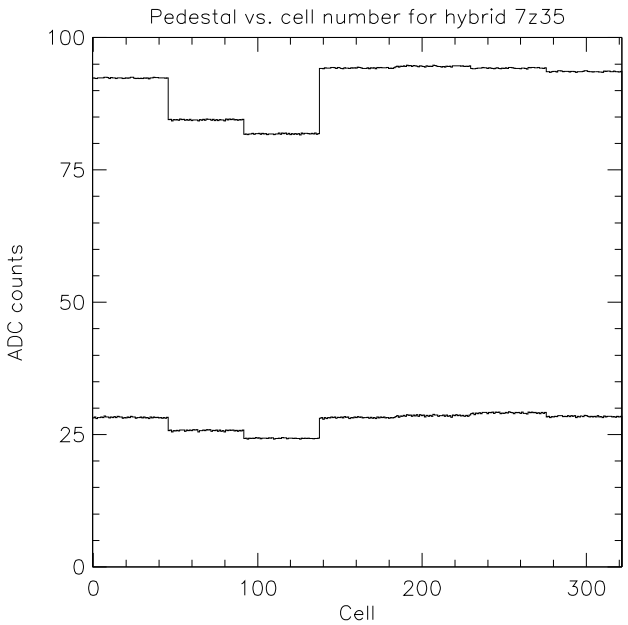

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

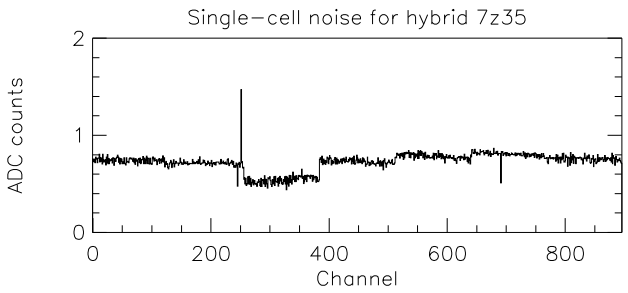

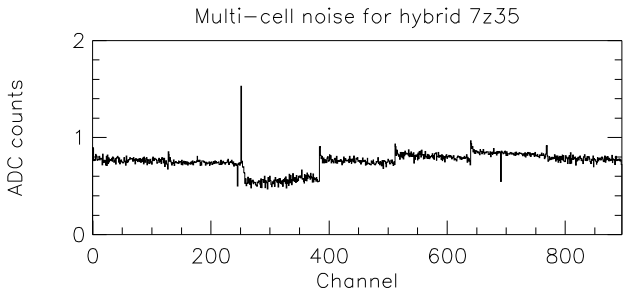

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

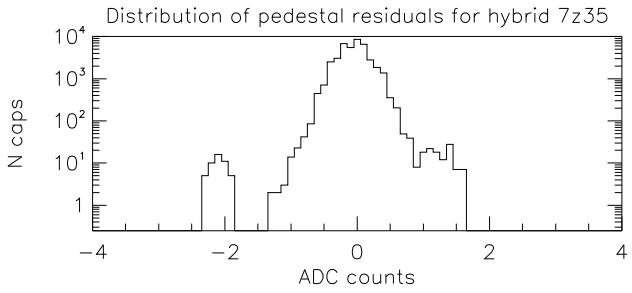

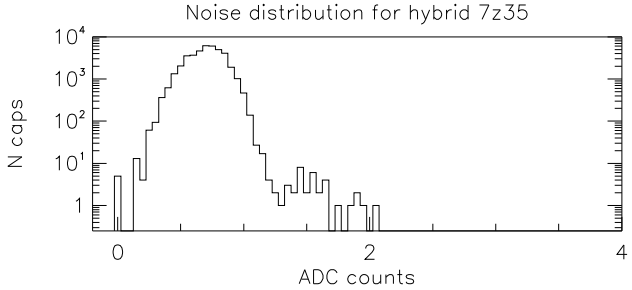

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
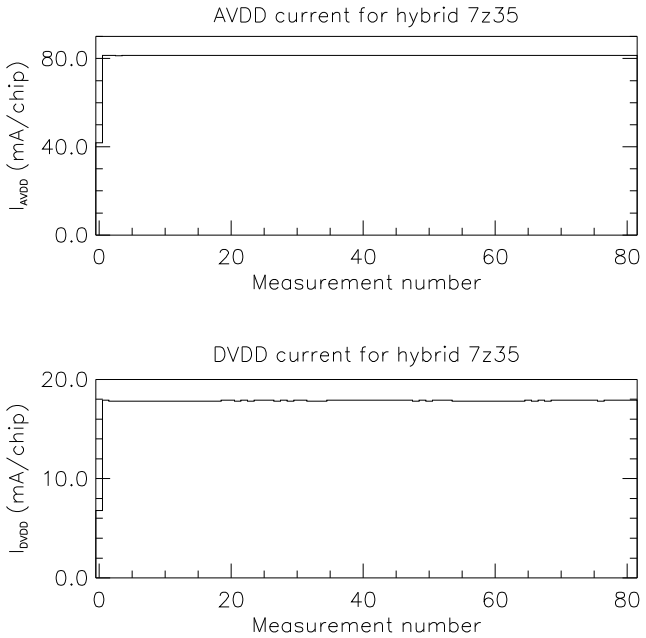
Supply Currents During Burn-in