# Hybrid 8j10 Traveler

November 15, 1999

## 1 Connectivity

Repairs on shorts:

Fixes for opens:

## 2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J10 has die: 064-026 064-027 064-029 064-031 058-030 058-031 058-034 058-035

## 3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j10 classification info. Created 18:34:55 11/15/99

Hybrid 8j10 quality: fair
Chip classification: good fair good good good good good good
Bad channels (chip-channel): 1-98
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 33.7 31.7 34.7 35.1 36.2 34.6 32.6 33.7
```

# 4 Comments

fixed some wirebonds on chip 1

# 5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

**Pedestal for each Channel**

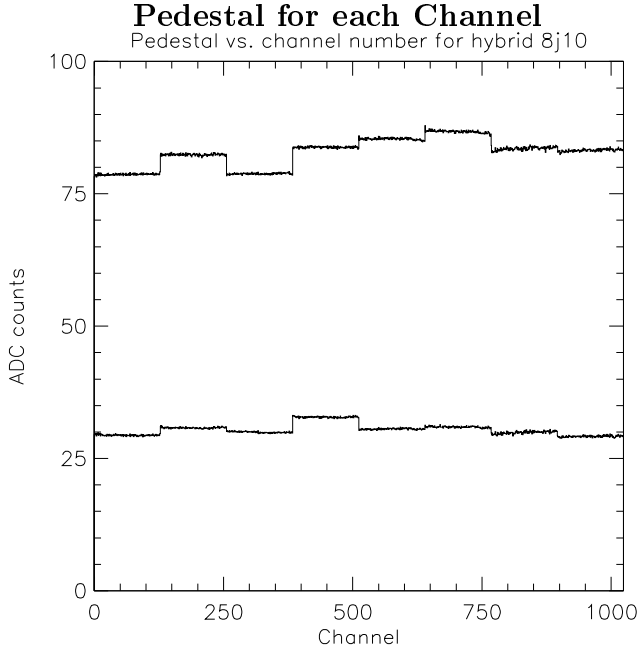


The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

**Pedestal vs. Pipeline Cell ID**

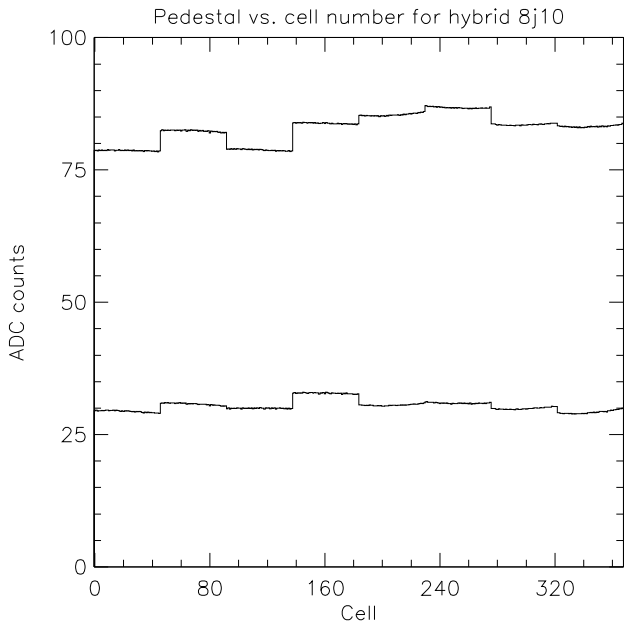

# 6 Noise

The following plots show the single-cell and multi-cell RMS noise:

**RMS Noise**

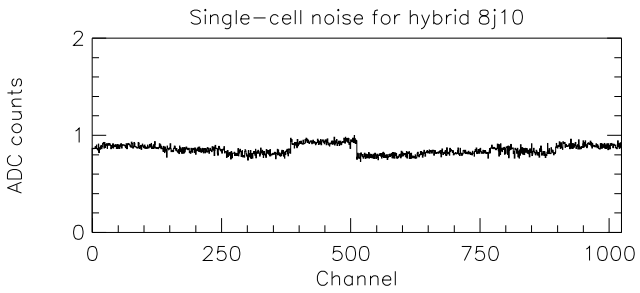


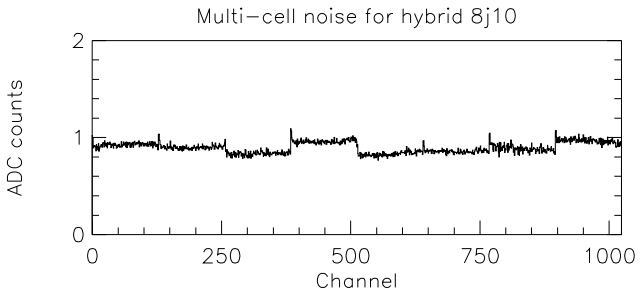


The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

**Distribution of Pedestals and Noise**

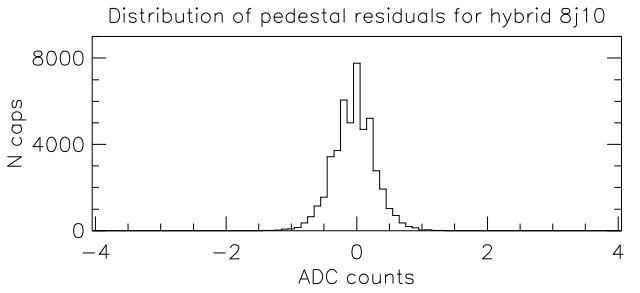


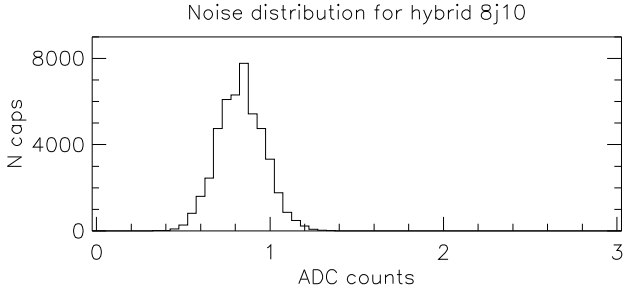

# 7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
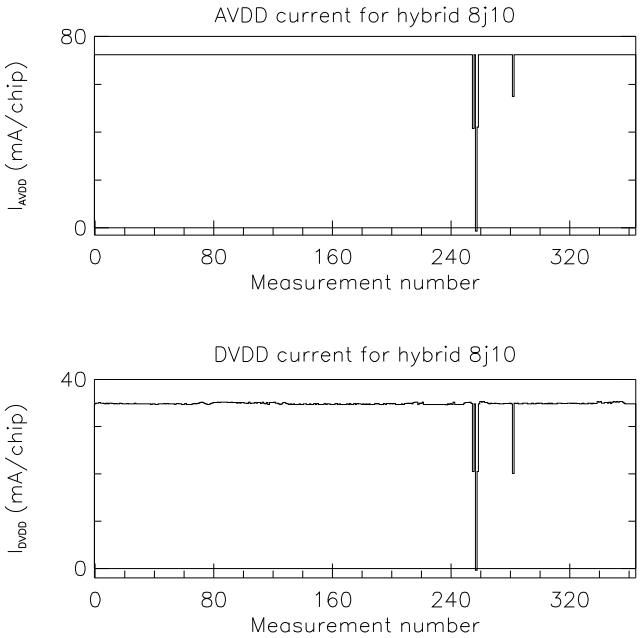
**Supply Currents During Burn-in**