Hybrid 8j139 Traveler

January 4, 2000

1 Connectivity

Repairs on shorts:

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J139 has die: 197-066 197-067 197-068 199-065 199-086 199-087 199-088 199-094

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j139 classification info. Created 13:52:52 12/22/99

Hybrid 8j139 quality: fair
Chip classification: fair fair good fair fair good fair good
Bad channels (chip-channel): 0-71 1-82 4-79
Bad cells: none
Random bad capacitors (chip-cell-channel): 1-3-104 1-30-69 3-33-104
   6-29-91 6-35-124
Channels at pedestal needed for DCMS: 32.7 31.6 31.7 32.7 30.8 33.6 32.6 31.8
```

4 Comments

No comments.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

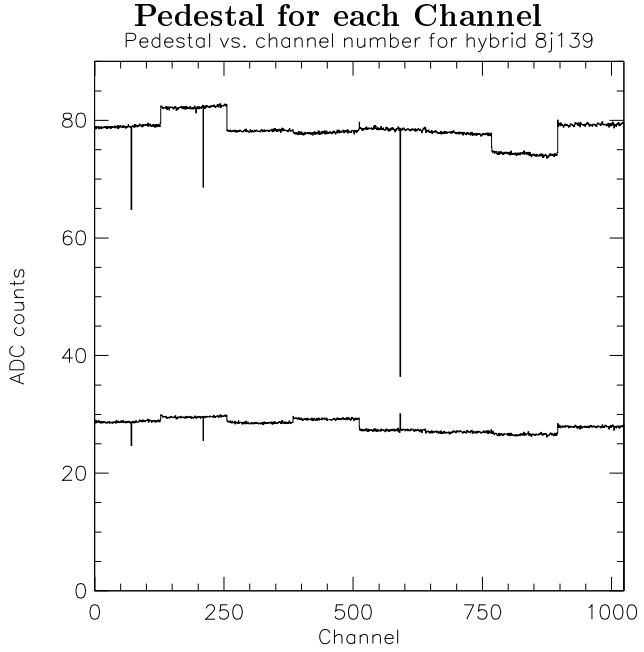

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

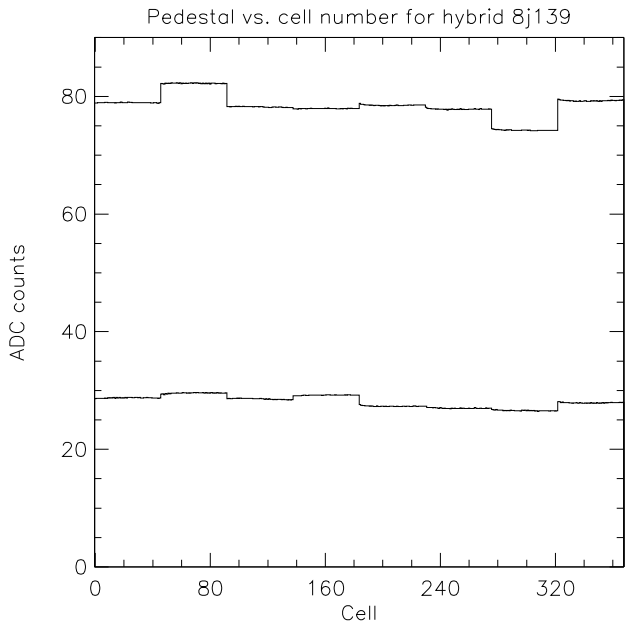

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

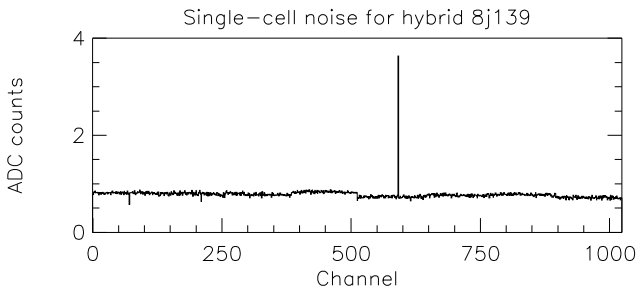

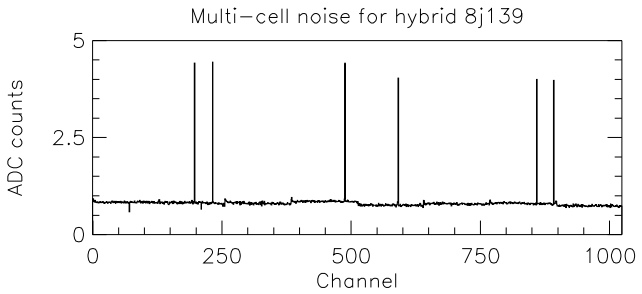

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

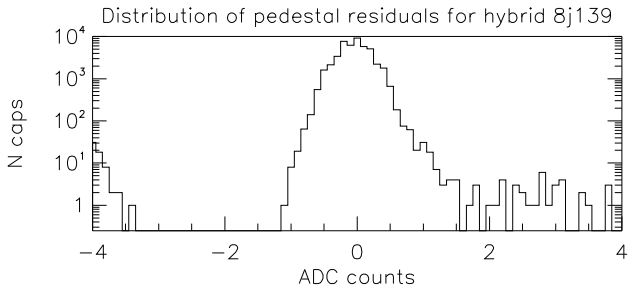

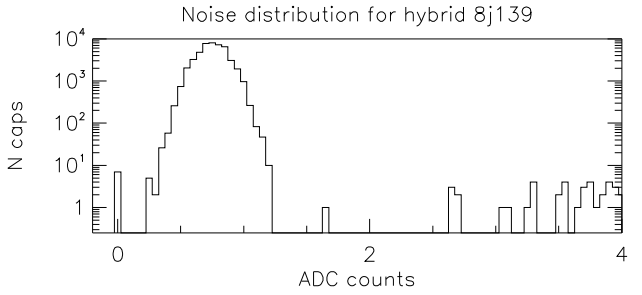

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
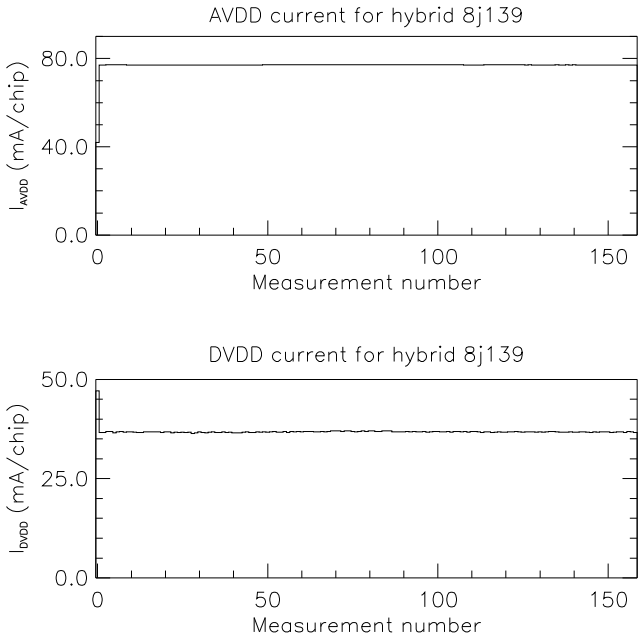
Supply Currents During Burn-in