Hybrid 8j204 Traveler

February 9, 2000

1 Connectivity

Repairs on shorts:

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J204 has die: 177-099 177-100 177-101 177-103 179-085 179-086 179-088 179-092

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j204 classification info. Created 11:20:38 02/09/00

Hybrid 8j204 quality: fair
Chip classification: good good fair good good good fair good
Bad channels (chip-channel): 2-16
Bad cells: none
Random bad capacitors (chip-cell-channel): 6-30-4 6-33-4 6-34-4
   6-37-4 6-39-4 6-4-4 6-41-4
Channels at pedestal needed for DCMS: 33.6 32.7 34.7 32.8 33.6 35.6 35.6 32.7
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

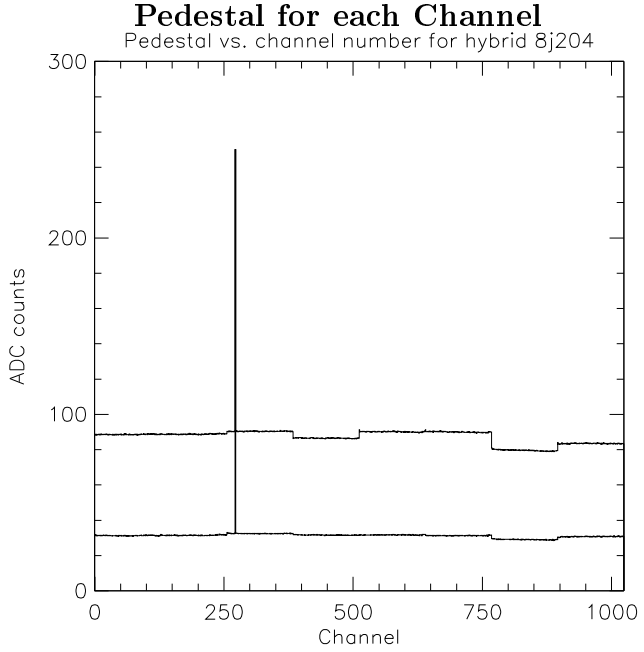

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

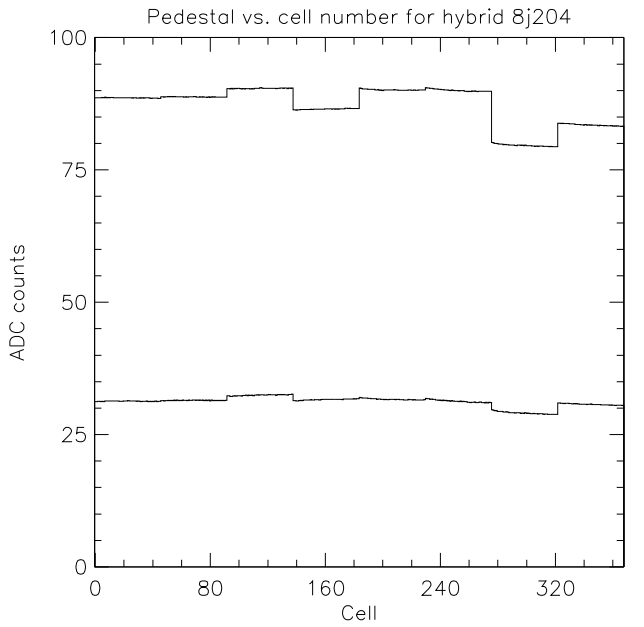

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

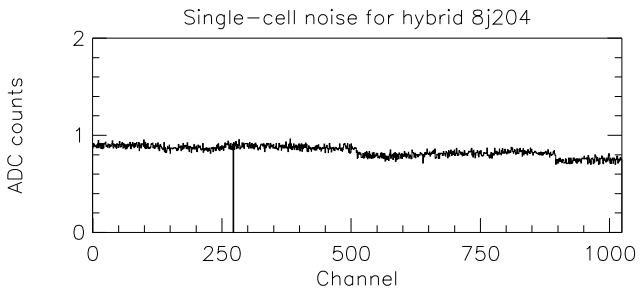

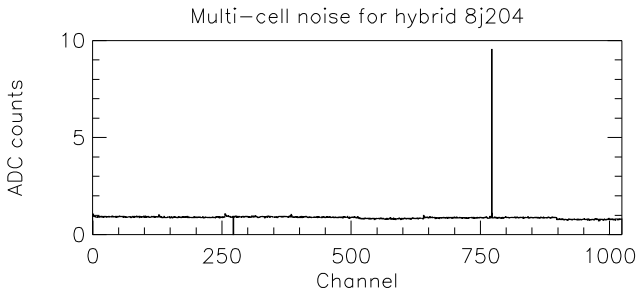

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

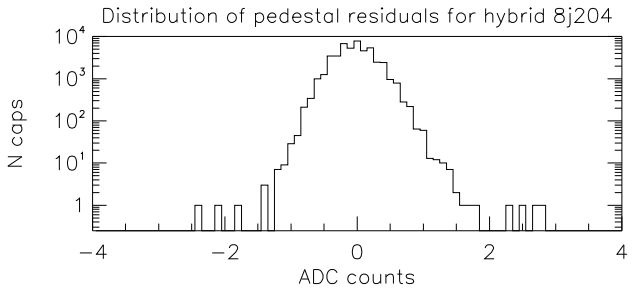

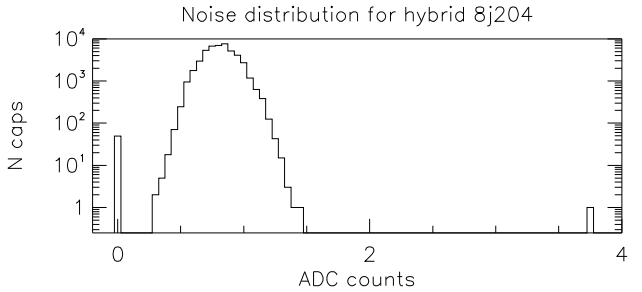

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
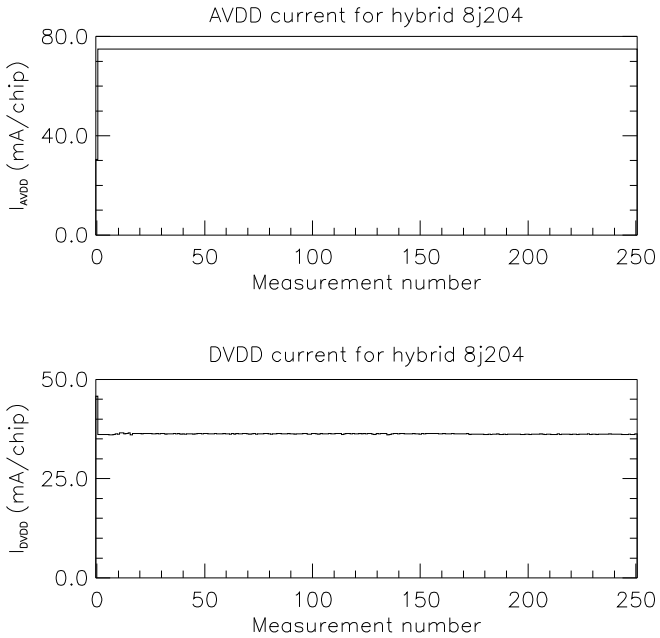
Supply Currents During Burn-in