Hybrid 8j249 Traveler

May 31, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J249 has die: 143-054 143-057 143-058 143-059 178-103 178-104 178-109 178-111

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j249 classification info. Created 15:20:57 05/29/00

Hybrid 8j249 quality: fair
Chip classification: good good good good fair fair fair good
Bad channels (chip-channel): 4-88 5-16 5-121 6-65 6-115
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 31.7 32.6 31.6 31.7 33.6 35.6 33.6 33.6
```

4 Comments

HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

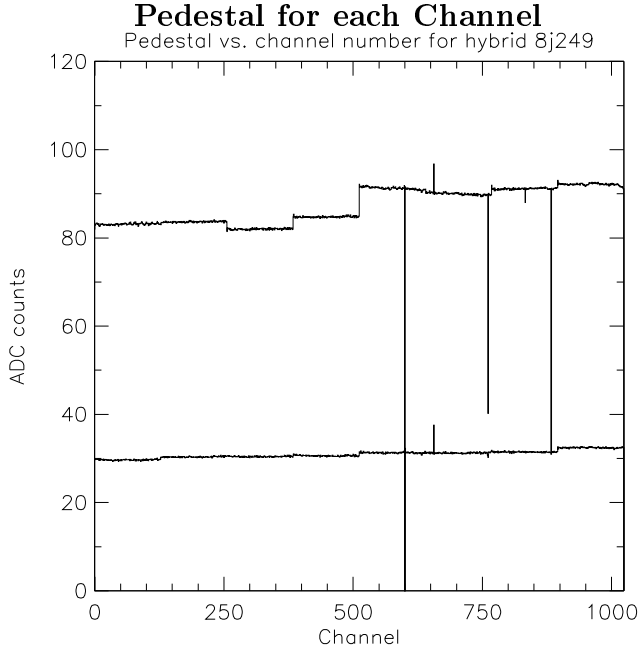

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

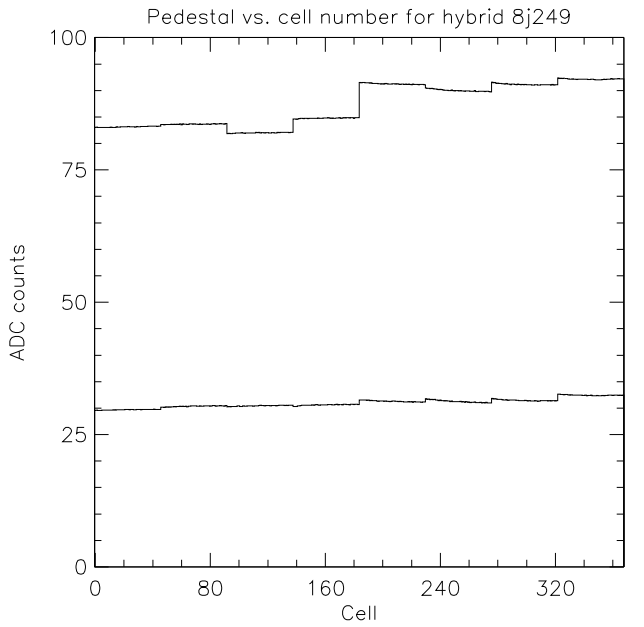

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

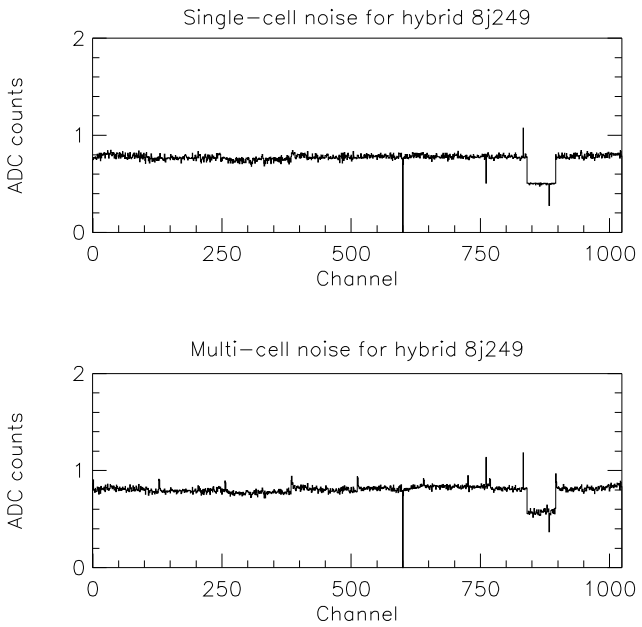

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

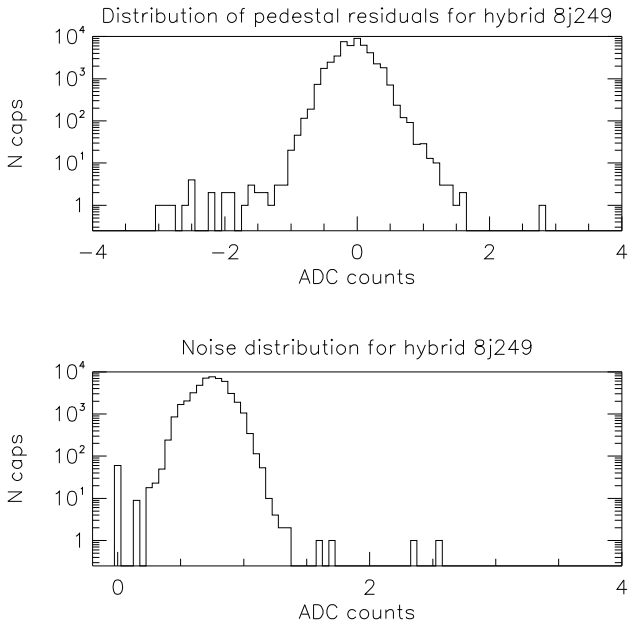

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
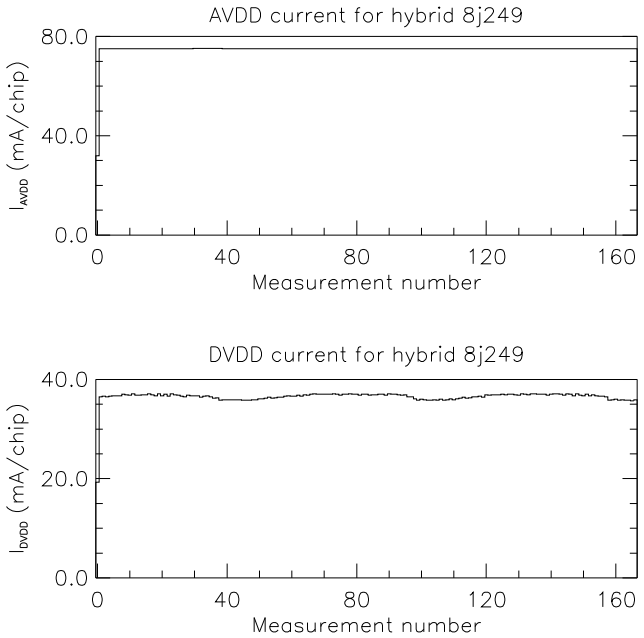
Supply Currents During Burn-in