Hybrid 8j253 Traveler

February 25, 2000

1 Connectivity

Repairs on shorts:

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J253 has die: 174-013 174-014 174-018 174-019 175-092 175-093 175-094 175-096

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j253 classification info. Created 10:13:44 02/25/00

Hybrid 8j253 quality: fair
Chip classification: good good fair good good good good fair
Bad channels (chip-channel): 2-22
Bad cells: none
Random bad capacitors (chip-cell-channel): 2-33-21 2-34-21 2-36-21
   2-42-21 2-6-21 2-7-21 7-43-108
Channels at pedestal needed for DCMS: 31.3 32.6 32.6 32.6 33.6 33.5 35.6 35.7
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

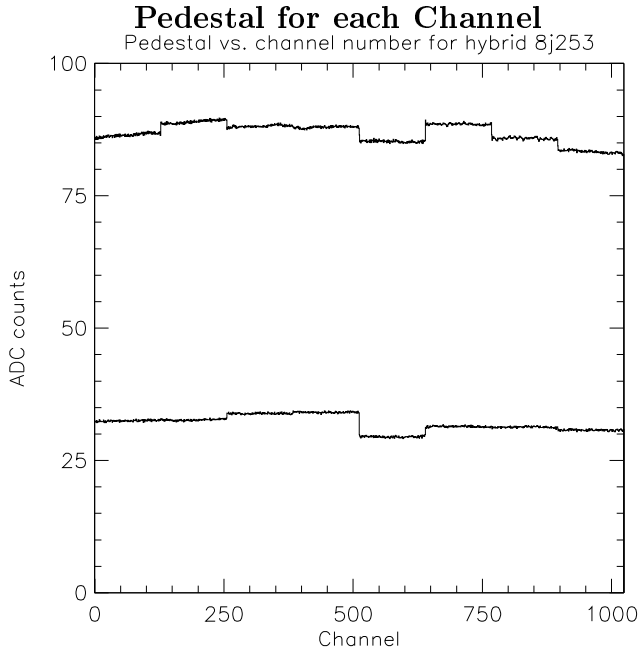

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

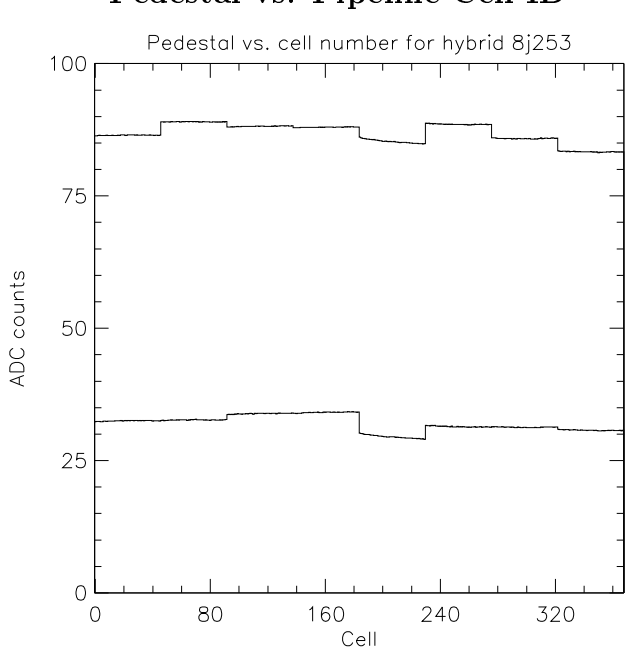

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

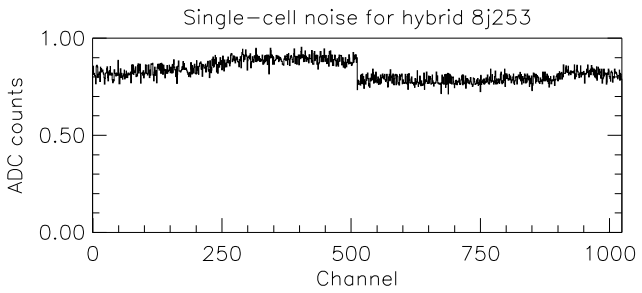

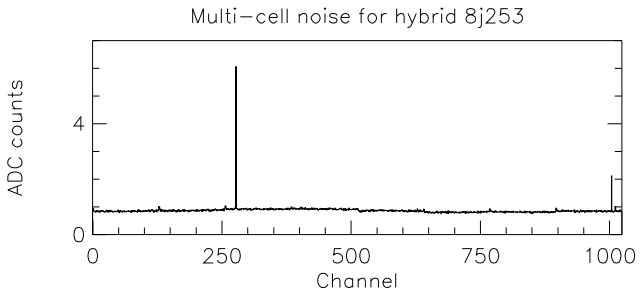

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

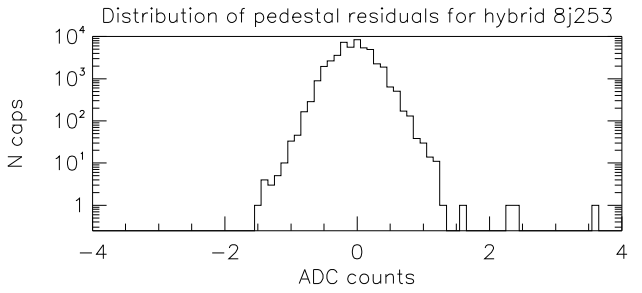

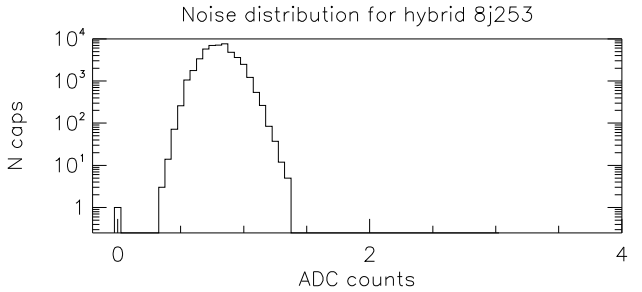

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
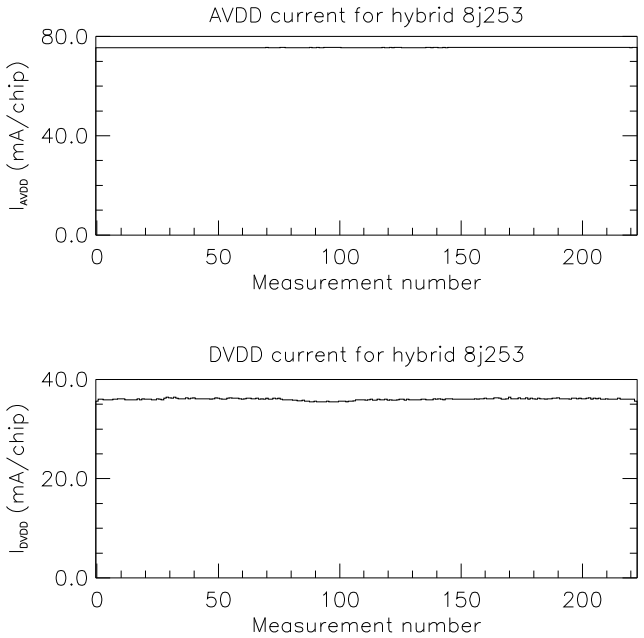
Supply Currents During Burn-in