Hybrid 8j304 Traveler

May 10, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J304 has die: 156-018 156-020 156-021 156-023 158-093 158-094 158-095 158-096

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j304 classification info. Created 11:13:13 05/10/00

Hybrid 8j304 quality: fair
Chip classification: good good good good good good fair good
Bad channels: none
Bad cells: none
Random bad capacitors (chip-cell-channel): 6-10-82 6-13-38 6-16-38
   6-18-38 6-20-38 6-29-38 6-29-39 6-42-38
Channels at pedestal needed for DCMS: 30.6 29.6 30.7 31.7 31.6 33.6 32.7 31.6
```

4 Comments

HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

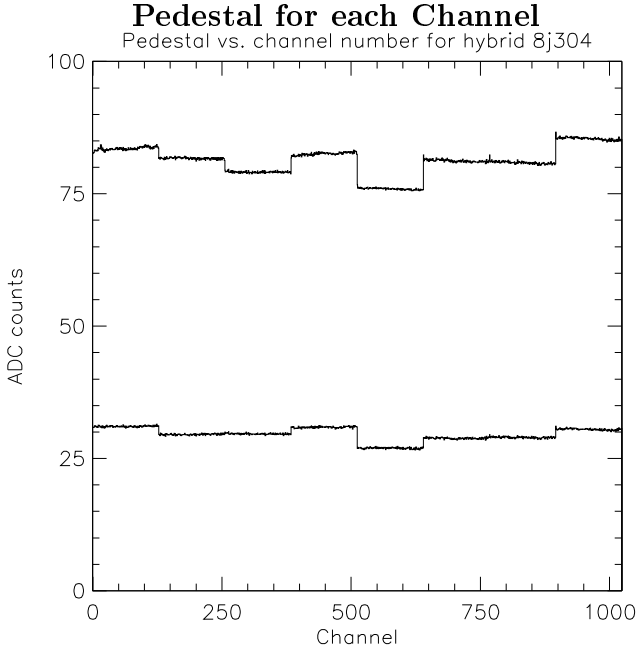

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

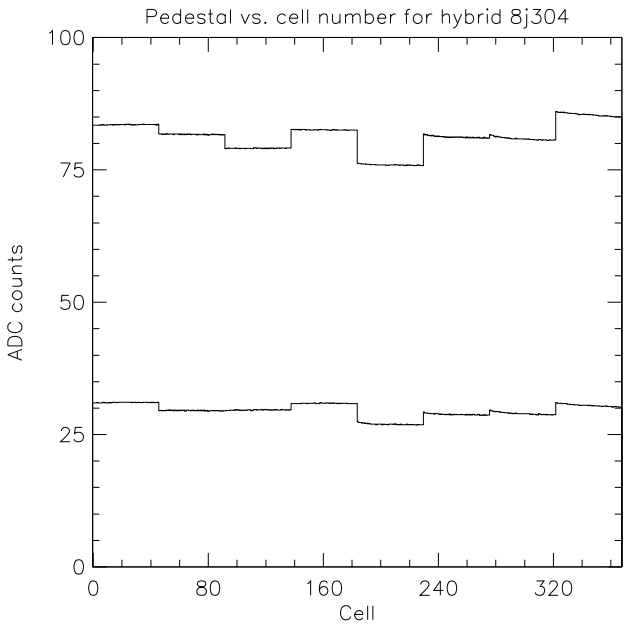

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

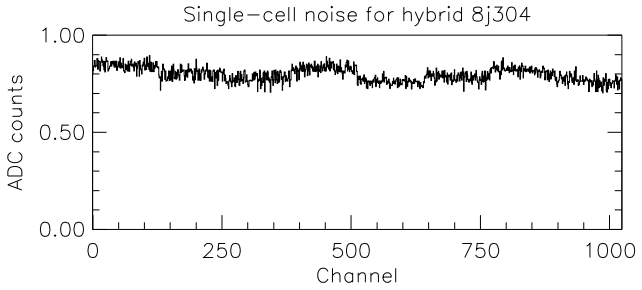

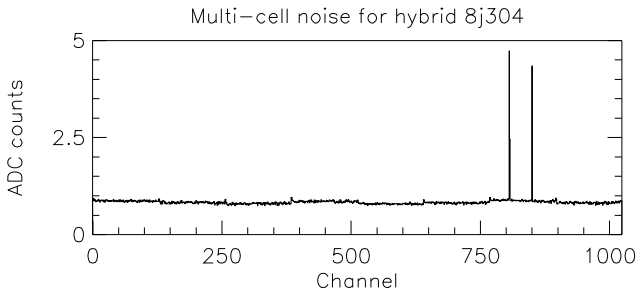

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

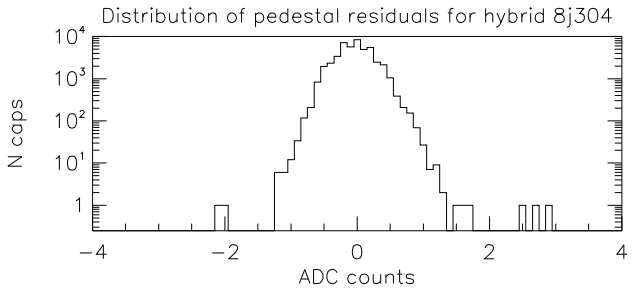

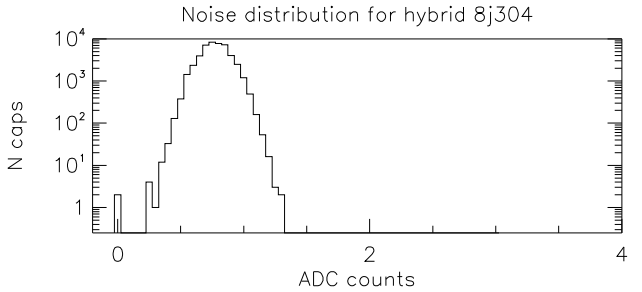

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
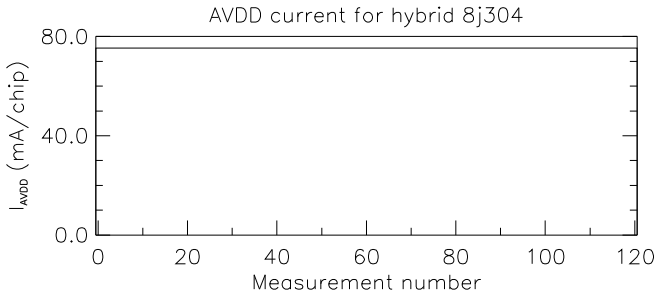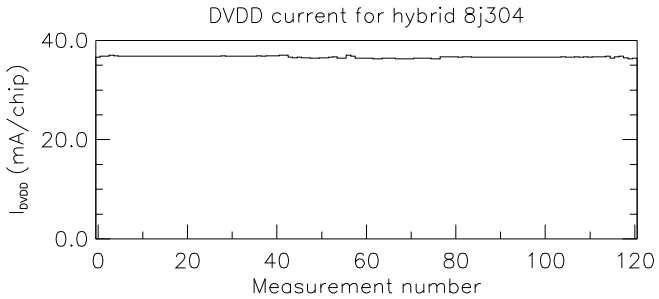
Supply Currents During Burn-in