Hybrid 8j351 Traveler

July 14, 2000

1 Connectivity

Repairs on shorts:
Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J351 has die: 236-047 236-048 236-053 236-055 246-061 246-062 246-063 246-068

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j351 classification info. Created 11:26:30 07/07/00

Hybrid 8j351 quality: fair
Chip classification: fair good good good good fair fair good
Bad channels (chip-channel): 0-102 5-72 6-39
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 30.6 31.6 30.6 30.6 31.6 31.6 31.7 33.4
```

4 Comments

HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

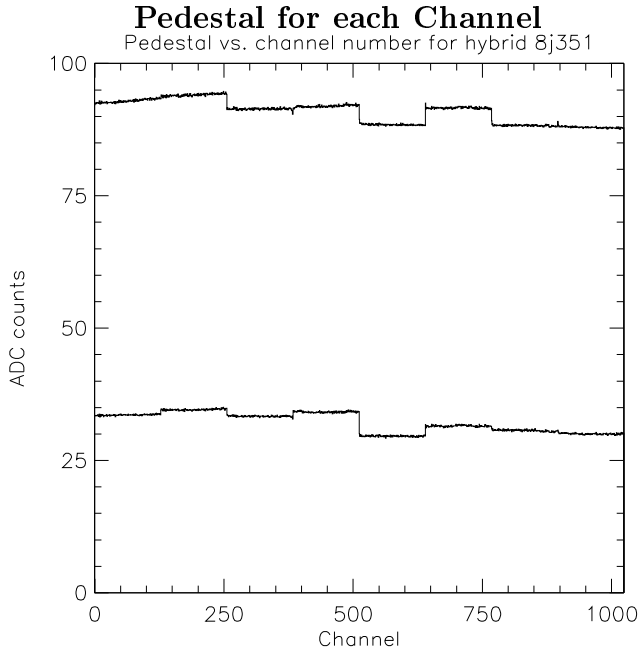

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

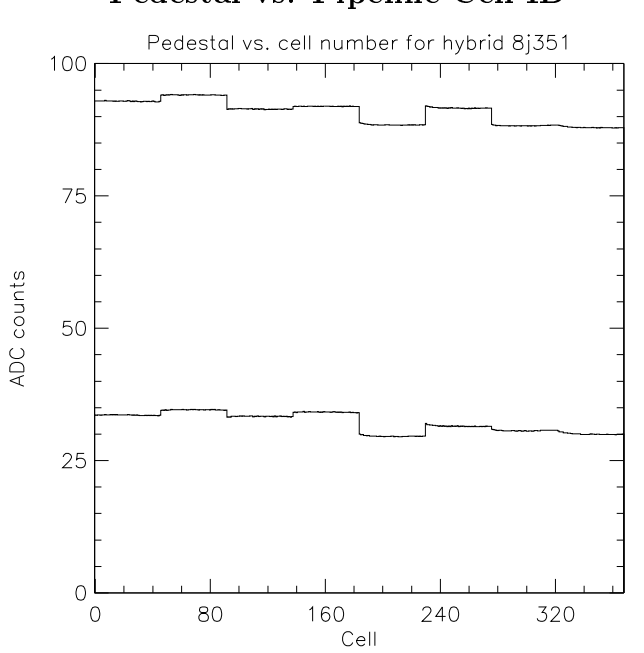

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

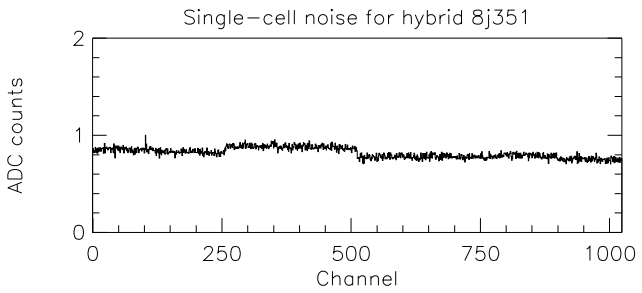

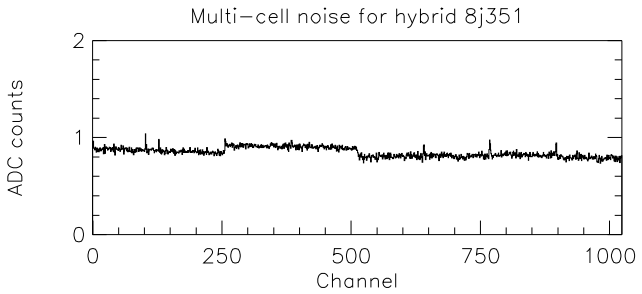

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

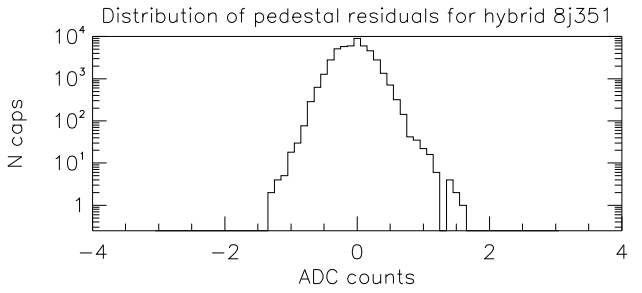

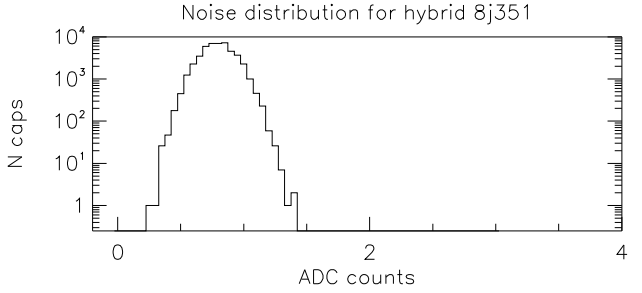

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
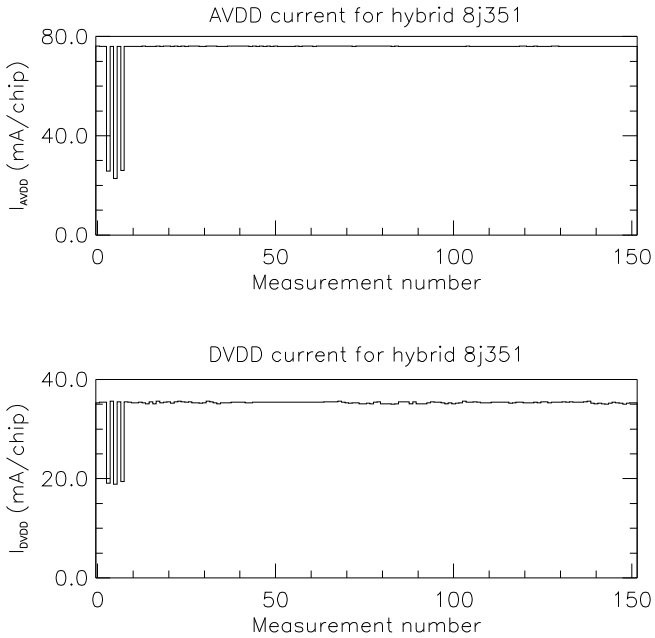
Supply Currents During Burn-in