Hybrid 8j5 Traveler

November 15, 1999

1 Connectivity

Repairs on shorts:

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J5 has die: 065-017 065-019 065-023 065-025 060-029 060-030 060-031 060-032

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j5 classification info. Created 18:39:25 11/15/99

Hybrid 8j5 quality: fair
Chip classification: good fair good good good good good good
Bad channels: none
Bad cells: none
Random bad capacitors (chip-cell-channel): 1-29-108
Channels at pedestal needed for DCMS: 33.7 34.7 33.1 35.7 36.6 36.5 36.6 35.6
```

4 Comments

wire bonds on the transceiver were redone at the upper right corner area as they were smashed.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

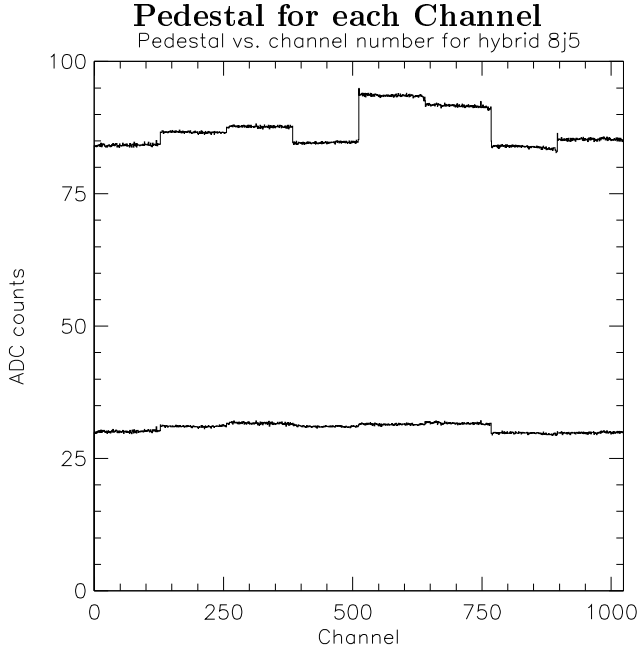

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

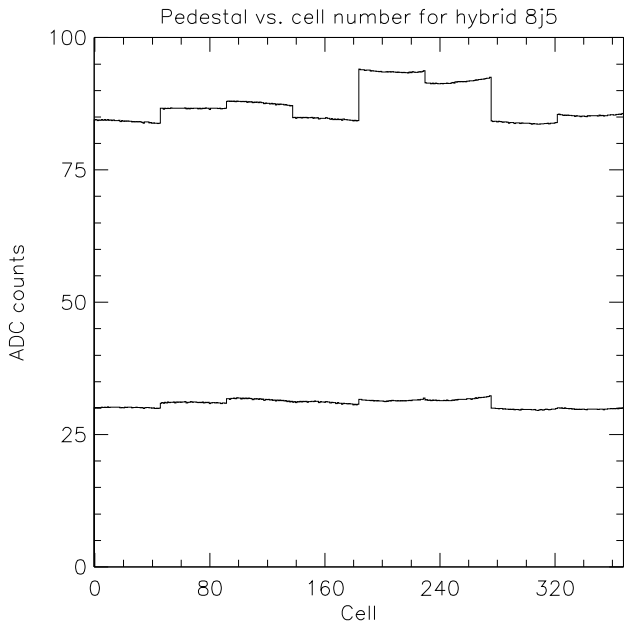

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

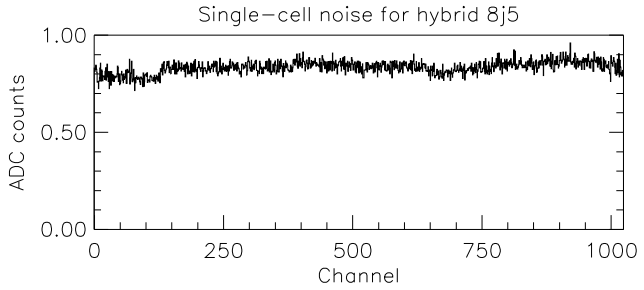

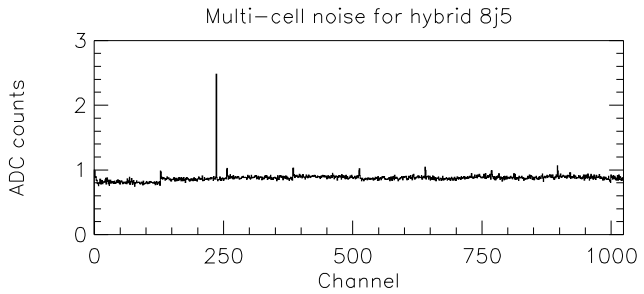

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

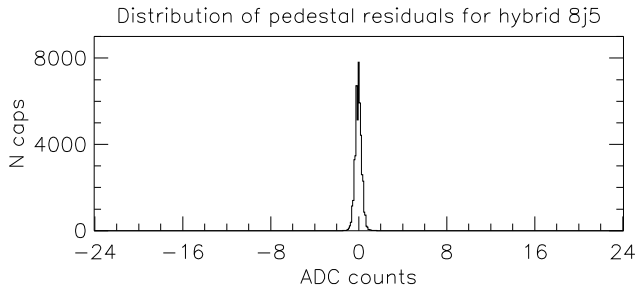

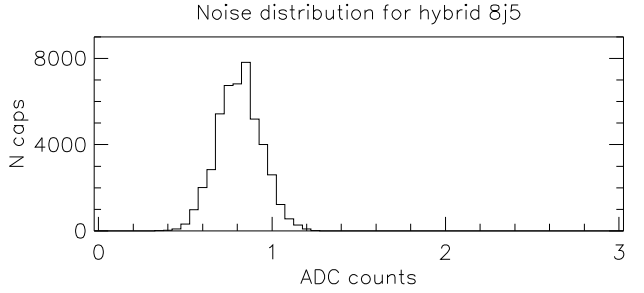

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
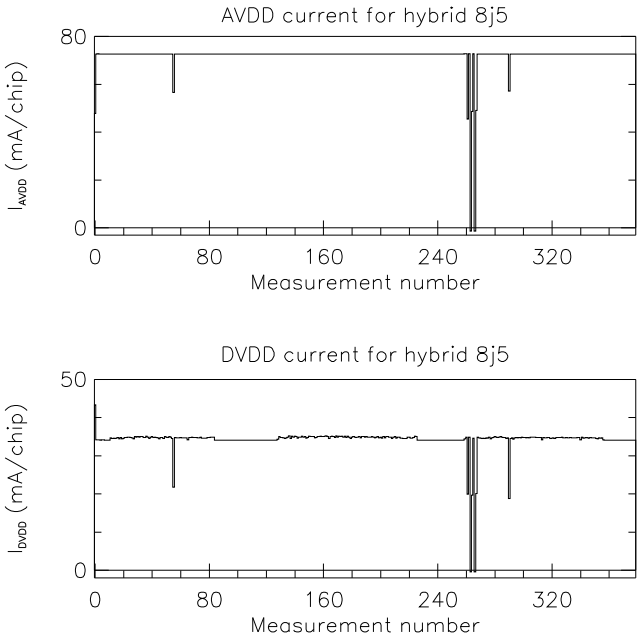
Supply Currents During Burn-in