Hybrid 8j82 Traveler

November 15, 1999

1 Connectivity

Repairs on shorts:

Fixes for opens:

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 8J82 has die: 090-010 090-011 090-012 090-013 098-029 098-030 098-031 098-032

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 8j82 classification info. Created 12:32:13 11/15/99

Hybrid 8j82 quality: fair
Chip classification: good good good fair fair fair fair fair
Bad channels (chip-channel): 3-76 4-25 5-109 6-59 7-50
Bad cells: none
Random bad capacitors (chip-cell-channel): 3-18-37 3-24-76 5-3-48
   6-20-59
Channels at pedestal needed for DCMS: 35.7 35.6 34.4 34.6 34.7 34.2 34.6 35.6
```

4 Comments

No comments.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

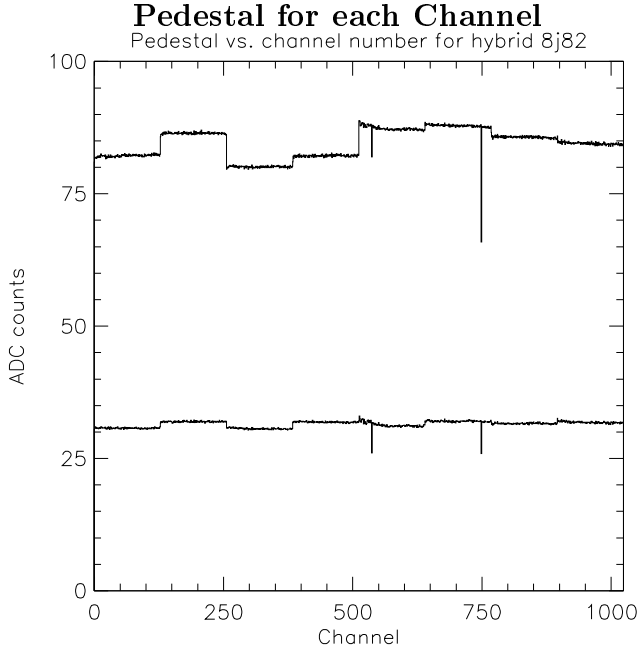

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

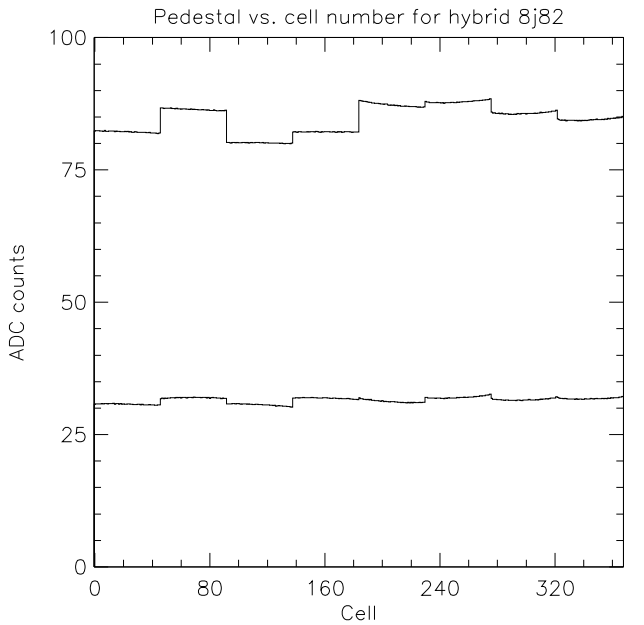

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

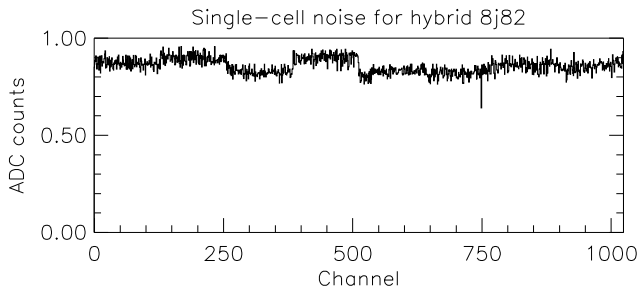

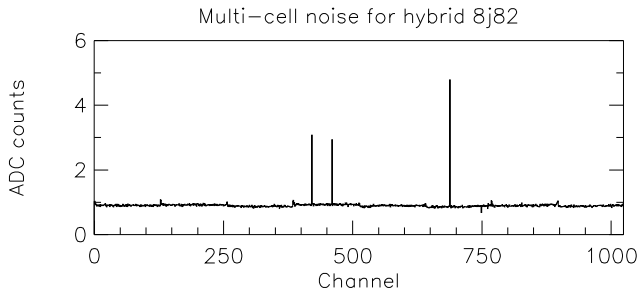

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

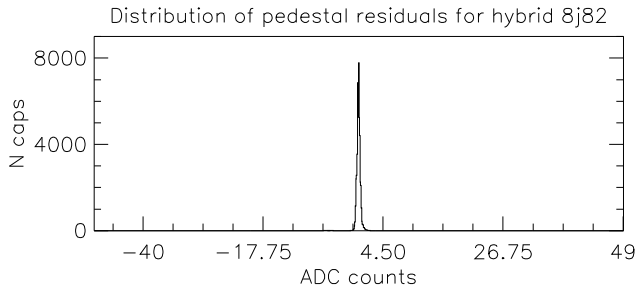

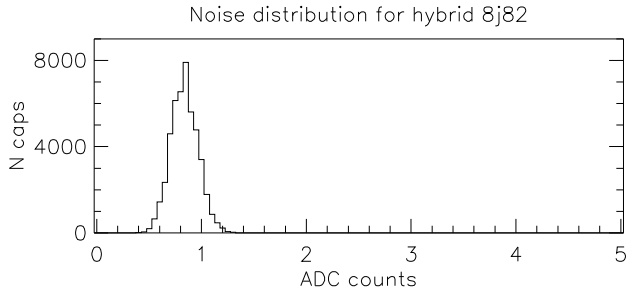

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
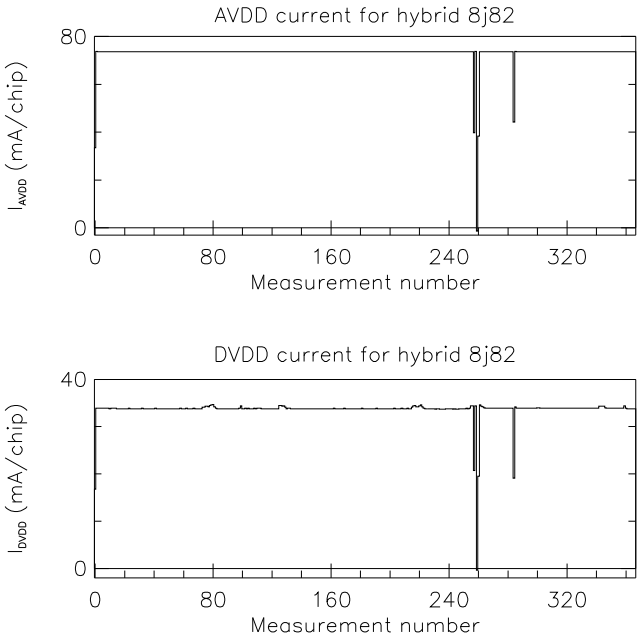
Supply Currents During Burn-in