Hybrid 7z161 Traveler

June 8, 2000

1 Connectivity

Repairs on shorts: DVDD short to DGND fixed.
Fixes for opens: L1A open to chips 2 and 7 fixed.

2 Chips

The following chips were assembled on this hybrid (in the order that the chips get read out):
Hybrid 7Z161 has die: 169-124 169-127 169-128 169-129 169-131 169-134 170-003

3 Data Analysis Summary

The following summarizes the findings of the Burn-in data analysis program. The first chip in the readout name is numbered 0.

```
% Hybrid 7z161 classification info. Created 10:48:14 06/02/00

Hybrid 7z161 quality: good
Chip classification: good good good good good good good
Bad channels: none
Bad cells: none
Random bad capacitors: none
Channels at pedestal needed for DCMS: 30.7 35.6 30.7 31.7 33.7 30.6 30.7
```

4 Comments

Encapsulated. FE DV finger gold bonds. HV tested.

5 Pedestal

The following plot shows the pedestals vs. channel number with and without charge injection:

Pedestal for each Channel

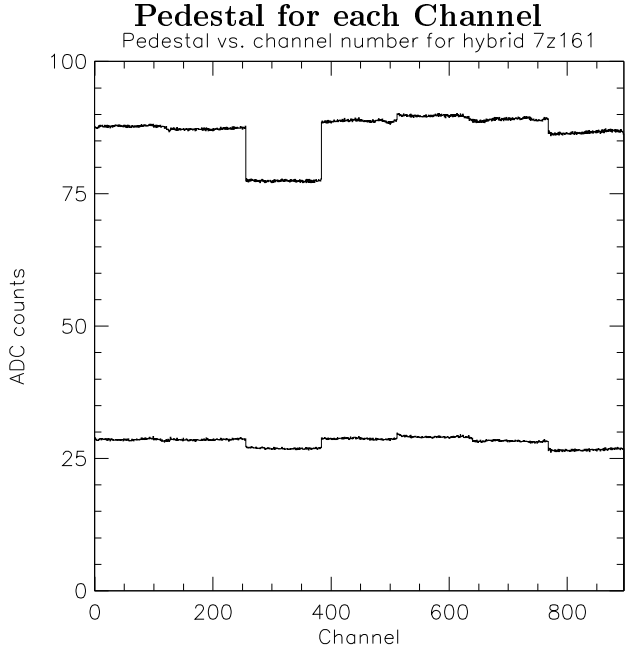

The following plot shows the average pedestal vs. pipeline cell ID with and without charge injection. The x-axis is cell ID offset by 46 for each chip. Thus cell ID 5 for chip 1 is at x=5, chip 2 at x=51, chip 3 at x=97, etc.

Pedestal vs. Pipeline Cell ID

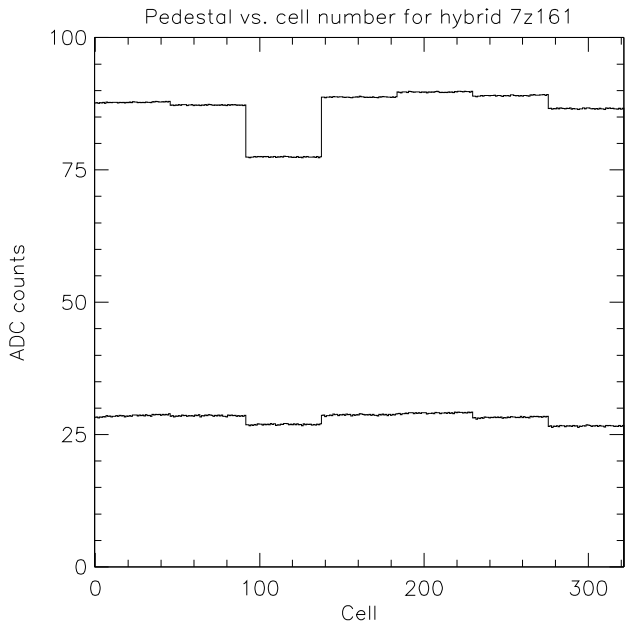

6 Noise

The following plots show the single-cell and multi-cell RMS noise:

RMS Noise

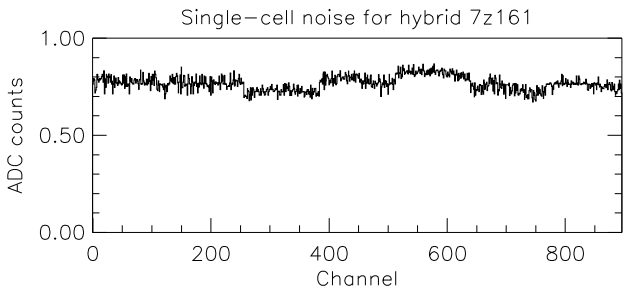

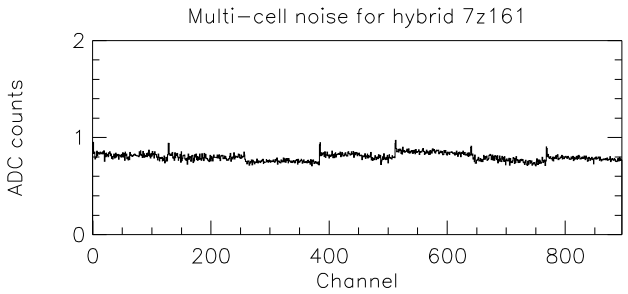

The following are histograms of the pedestal of each pipeline capacitor relative to the chip average (top); and the RMS noise of each capacitor (bottom):

Distribution of Pedestals and Noise

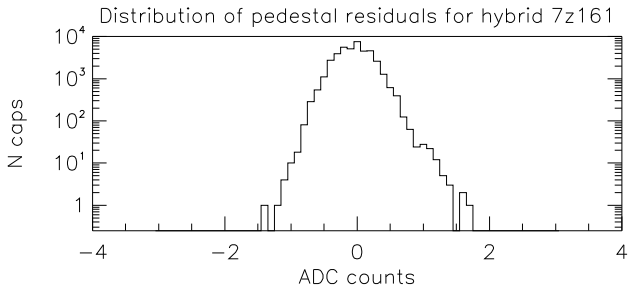

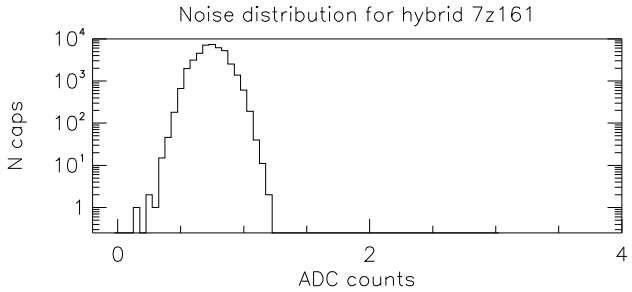

7 Currents

The following plots show the supply currents per chip as a function of measurment number. Currents are measured approximately every 10 minutes:
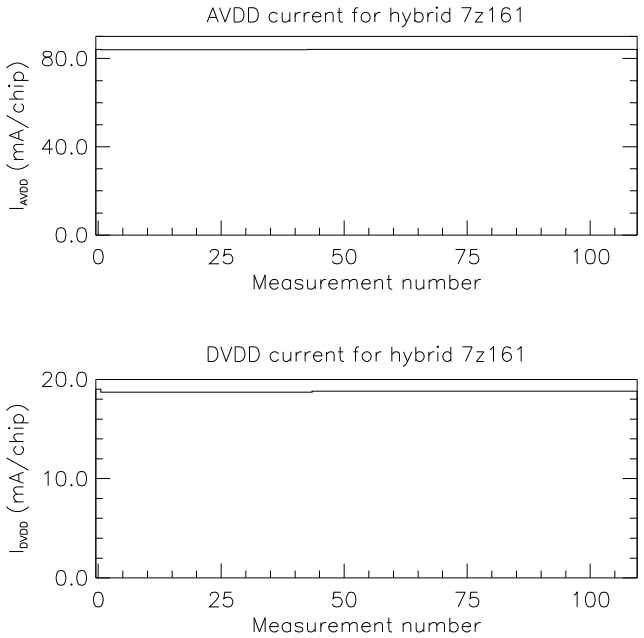
Supply Currents During Burn-in